Waste Tank Summary Report for Month Ending December 31, 1996



Prepared for the U.S. Department of Energy Office of Environmental Restoration and Waste Management

Project Hanford Management Contractor for the U.S. Department of Energy under Contract DE-AC06-96RL13200

Approved for public release; distribution unlimited

LEGAL DISCLAIMER.

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government or any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or essumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof. agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

DISCLM-2.CHP (1-91)

Waste Tank Summary Report for Month Ending December 31, 1996

B. M. Hanlon Lockheed Martin Hanford Corporation

Date Published March 1997

Prepared for the U.S. Department of Energy Office of Environmental Restoration and Waste Management

Project Hanford Management Contractor for the U.S. Department of Energy under Contract DE-AC06-96RL13200

Approved for public release; distribution unlimited

RELEASE AUTHORIZATION

Document Number:

HNF-EP-0182-105

Document Title:

Waste Tank Summary Report for Month Ending December

31, 1996

Release Date:

3/14/97

This document was reviewed following the procedures described in WHC-CM-3-4 and is:

APPROVED FOR PUBLIC RELEASE

WHC Information Release Administration Specialist:

Kara M. Broz

March 14, 1997

APPROVALS

Prepared by:

Responsible Manager: G. L. Dunford, Manager Date West Tank Farms Engineering Support

This page intentionally left blank.

WASTE TANK SUMMARY REPORT

B. M. Hanlon

ABSTRACT

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 63 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U. S. Department of Energy-Richland Operations Office Order 5820.2A, Chapter I, Section 3.e. (3) (DOE-RL, 1990, Radioactive Waste Management, U. S. Department of Energy-Richland Operation Office, Richland, Washington) requiring the reporting of waste inventories and space utilization for Hanford Tank Farm Tanks.

This page intentionally left blank.

CONTENTS

I.		. 1
Appe	endixes:	
Α.	WASTE TANK SURVEILLANCE MONITORING TABLES	A-2 A-3 A-4 A-6 A-7 A-13 A-15
В.	DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION	B-2
	<u>Figures:</u> 1 Total Double-Shell Tank Total Inventory	B-5
C.	TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS	C-1 C-2
D.	TANK FARM CONFIGURATION, STATUS AND FACILITY CHARTS	D-2 D-3 D-4 D-5/6
Ε.	MONTHLY SUMMARY	
	1 Monthly Summary	E-3 E-4 E-5 E-6
F.	PERFORMANCE SUMMARY	. F-1
	 1 Performance Summary 2 Summary of Waste Transactions in the Double-Shell Tanks 3 Comparison of Projected Versus Actual Waste Volumes for 	. F-4
	Hanford Facilities	. F-5

G.	MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES
	Tables: 1 Miscellaneous Underground Storage Tanks and Special Surveillance Facilities (Active)
Н.	LEAK VOLUME ESTIMATES
	<u>Table:</u> 1 Single-Shell Tank Leak Volume Estimates
I.	SINGLE-SHELL TANKS INTERIM STABILIZATION, AND CONTROLLED, CLEAN AND STABLE STATUS
	1 Single-Shell Tanks Interim Stabilization Status
	Schedule
J.	CHARACTERIZATION PROGRESS STATUS
	<u>Figure:</u> 1 Characterization Progress Status J-2

METRIC CONVERSION CHART							
1 inch		=	2.54 centimeters				
l foot		=	30.48 centimeters				
l gallon		=	3.80 liters				
l ton		11	0.90 metric tons				

1 Btu/h = 2.930711 E-01 watts (International Table)

WASTE TANK SUMMARY REPORT FOR MONTH ENDING DECEMBER 31, 1996

Note: Changes from the previous month are in bold print.

I. WASTE TANK STATUS

Category	Quantity	Date of Last Change
Double-Shell Tanks ^c	28 double-shell	10/86
Single-Shell Tanks ^a	149 single-shell	07/88
Assumed Leaker Tanks ^f	67 single-shell	7/93
Sound Tanks	28 double-shell 82 single-shell	1986 7/93
Interim Stabilized Tanks ^{b,d}	116 single-shell	12/96
Not Interim Stabilized ^f	33 single-shell	12/96
Intrusion Prevention Completed ^e	108 single-shell	09/96
Controlled, Clean, and Stable ⁱ	36 single-shell	09/96 -
Watch List Tanks ⁹ Total	32 single-shell 6 double-shell 38 tanks	9/96 ^h 6/93

a All 149 single-shell tanks were removed from service (i.e., no longer authorized to receive waste) as of November 21, 1980.

^b Of the 116 tanks classified as Interim Stabilized, 62 are listed as Assumed Leakers. The total of 116 Interim Stabilized tanks includes one tank (B-202) that does not meet current established supernatant and interstitial liquid stabilization criteria. (See Table I-1 footnotes, item #2)

^C Six double-shell tanks are currently included on the Hydrogen Watch List and are thus prohibited from receiving waste in accordance with "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the <u>National Defense Authorization Act for Fiscal Year 1991</u>, November 5, 1990, Public Law 101-510.

d Of the 32 single-shell tanks on Watch Lists, 11 have been Interim Stabilized.

e Of the 32 single-shell tanks on Watch Lists, 11 have completed Intrusion Prevention (this category replaced Interim Isolation). (See Appendix C for "Intrusion Prevention" definition).

 $^{^{}m f}$ Five of these tanks are Assumed Leakers. (See Table H-1) Tank SX-102 was declared an Assumed Leaker in May, and reclassified as Sound in July, 1993. See "Waste Tank Investigations" section of the July 1993 report for more details.

g See Section A tables for more information on Watch List Tanks. Eight tanks (A-101, S-102, S-111, SX-103, SX-106, U-103, U-105, and U-107) are currently on more than one Watch List.

h Dates for the Watch List tanks are "officially added to the Watch List" dates. (See Table A-1, Watch List Tanks, for further information.)

The TY tank farm was officially declared Controlled, Clean, and Stable in March 1996. The TX tank farm and BX tank farms were declared CCS in September 1996. (BX-103 has been declared to have met current interim stabilization criteria, and is included in CCS - see also Appendix I).

II. WASTE TANK INVESTIGATIONS

This section includes all single-shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases, or drywell radiation level increases in excess of established criteria.

There are currently no tanks under investigation for ILL decreases or drywell radiation level increases which exceed the criteria. Drywell monitoring is done on an "as needed basis" with the exception of C-105 and C-106 which are monitored monthly.

A. Assumed Leakers or Assumed Re-leakers: (See Appendix C for definition of "Re-leaker")

This section includes all single- or double-shell tanks or catch tanks for which an <u>off-normal or unusual occurrence report has been issued for assumed leaks or re-leaks</u>. Tanks/catch tanks will remain on this list until either a) completion of Interim Stabilization, or b) the updated occurrence reportindicates that the tank/catch tank is not an assumed leaker.

There are currently no tanks for which an off-normal or unusual occurrence report has been issued for assumed leaks or re-leaks.

B. Tanks with increases indicating possible intrusions:

This section includes all single-shell tanks and related receiver tanks for which the surveillance data show that the <u>surface level or ILL has met or exceeded the increase criteria</u>, or are still being investigated.

<u>244-AR Tanks and Sumps</u>: Currently, all ventilation systems at 244-AR are shut down. Based on the weight factor gauges for the sumps and tanks, Tank 001 contains 1800-2400 gallons, Tank 002 contains 22,000-24,000 gallons (some unknown amount of sludge), Tank 003 contains 1400-2100 gallons, and Tank 004 contains 280-450 gallons. Intrusion water in Sump 003 continues to increase whenever rainfall occurs; the sump currently contains approximately 2900 gallons of water.

Increase criteria in the following tanks indicate possible intrusions: however, since no funds have been allocated for performing intrusion investigations in FY 1997, the details on these tanks are not included in this report. Complete information on these tanks will again appear in this report when intrusion investigation activities resume.

Tank 241-B-202 Tank 241-BX-101 Tank 241-BX-103

<u>Tank 241-C-101</u>: This tank has consistently read between 25.00 inches and 26.50 inches since 1981 until October 1994, when it dropped to 23.00 inches and remained there for the first three quarters of 1995. The tank was rebaselined to 23.00 inches during that time.

The manual tape is the primary surface level measurement device. Quarterly readings are as follows:

```
4th Qtr, 1996 - 24.50 inches taken on October 2
3rd Qtr, 1996 - 24.25 inches taken on July 1.
2nd Qtr, 1996 - 24.00 inches taken on April 1.
```

1st Qtr, 1996 - 26.25 inches taken on January 1, was over the increase criteria of 3.00 inches above baseline of 23.00 inches.

Resolution Status: The waste surface is dry. A previous investigation into surface level anomalies in this tank revealed that the manual tape device itself is inadequate. It was recommended to move the device to a different riser and/or install an ENRAF, but it was decided to first obtain in-tank videos to inspect the plummet and waste condition. Resolution is awaiting the in-tank video.

III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS

1. Flammable Gas Issue Results in Administrative Controls on 121 Underground Waste Storage Tanks

Administrative controls were placed on the 121 underground waste storage tanks not already covered by Watch List controls. Since saltwell pumping of flammable gas tanks is not within the current authorization basis, a safety analysis is required prior to pumping. Upon completion of the required safety analysis, DOE-RL will review the results and make a determination if pumping can commence.

In October 1996, DOE-RL established that an Unreviewed Safety Question (USQ) existed concerning flammable gas, and also approved an interim basis for continued operations through specific controls spelled out in East and West Tank Farms (DOE-RL approved) standing orders. Work affected by this action will resume in a controlled manner when the controls are validated and training is complete.

2. Additional Management Controls Placed on Organic Watch List Tanks

The Department of Energy (DOE) and Westinghouse Hanford have placed additional management controls to enhance safety on Hanford's underground radioactive waste storage tanks following a DOE decision to declare an "Unreviewed Safety Question" (USQ) on some tanks containing dry organic nitrate chemicals.

The presence of these chemicals has been well known for some time. Current safety analysis work has concluded that there is a small potential for an organic nitrate accident scenario.

3. Interim Stabilization

Tank 241-S-108 was declared interim stabilized on December 20, 1996, with a total waste of 450 Kgallons, drainable liquids of 4.0 Kgallons, and no pumpable liquids remaining. An in-tank video taken December 3 showed no supernate visible on the surface of the waste, which appears to be saltcake. See Table E-6 footnotes for further information.

4. Single-Shell Tanks Saltwell Jet Pumping (See Table E-6 footnotes for further information)

Tank 241-BY-109 - Pumping resumed on September 11, 1996. 3.5 Kgallons were pumped during October which is in excess of past pumpable liquid remaining estimates. Data generated by the current pumping campaign will be used to revise porosity, pumpable liquid remaining and waste volume estimates as appropriate. On October 16, the pump was shut down and left off in preparation for a transfer. A total of 154 Kgallons has been pumped from this tank.

<u>Tank 241-S-108</u> - Pumping was completed on September 12 and the tank was interim stabilized on December 20, 1996. (See item #3 above)

Tank 241-S-110 - Pumping resumed June 3, 1996, and was interrupted on July 16. There appears to be an impeller/shaft disconnect. Saltwell level has stabilized at 92 inches. Conservative estimates place porosity at .129, the amount of drainable fluids is estimated at 29.8 Kgallons, and pumpable liquid at 23.4 Kgallons. A total of 203.1 Kgallons has been pumped from this tank. An in-tank video was taken December 11 showing the tank as mostly dry with some fluid in the saltwell and around the saltwell screen. An evaluation declaring the tank interim stabilized has been drafted and is undergoing the review process.

<u>Tank 241-T-104</u> - Pumping started March 24, 1996. The pump failed August 26, and was replaced; pumping resumed September 9, and 5.2 Kgallons were pumped in October. A total of 89 Kgallons has been pumped. Pumping is now on hold pending detailed review of flammable gas issues.

5. Single-Shell Tank TPA Interim Stabilization Milestones

All M-41-xx Milestones are being renegotiated.

6. Tank Waste Remediation System Safety Initiatives

The U. S. Secretary of Energy has directed that six safety initiatives be implemented in the Tank Waste Remediation System Program to accelerate the mitigation/resolution of the high priority waste tank safety issues at the Hanford Site. Forty-two milestones were established for accomplishing the initiatives.

No Safety Initiatives were scheduled to be completed this month.

7. Characterization Progress Status (See Appendix J)

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

Characterization Progress for December:

The Characterization Program has not experienced much change this month due to mandatory regulations that have impacted the sampling operations. However, BY-107 has been evaluated as satisfying all the applicable Data Quality

Objectives, so is the 25th tank to be considered complete: The Safety Screening DQO for tank AY-101 has also been declared complete.

8. Gas Release Event in SY-103

A gas release event began in tank 241-SY-103 on December 20, 1996. Hydrogen concentrations in the dome space initially increased from 80 to 610 ppm within one minute. The concentration peaked at 5110 ppm (\leq 25% LFL). The hydrogen concentration had decreased to below 200 ppm on December 23.

The waste level dropped 2.4 inches, from 271.88 inches on December 20 to 269.48 inches on December 23.

The ammonia concentration began to increase on December 20 from an initial concentration of 17 ppm. The contraction was 70 ppm on December 21. It increased above 100 ppm 20 minutes later and peak concentrations of about 150 ppm were recorded during the afternoon of December 22. The concentration has been decreasing since then and was about 60 ppm on January 1.

Waste temperatures have dropped as much as 9 degrees in the nonconvective layer near the thermocouple tree in riser 4A, indicating that waste movement may have occurred in this region. No waste temperature changes occurred near the MIT on the opposite side of the tank.

This page intentionally left blank.

APPENDIX A

WASTE TANK SURVEILLANCE MONITORING TABLES

TABLE A-1. WATCH LIST TANKS December 31, 1996

These tanks have been identified as Watch List Tanks in accordance with Public Law 101-510, Section 3137,
"Safety Measures for Waste Tanks at Hanford Nuclear Reservation," (1990). These thanks have been identified as the
Priority 1 Hanford Site Tank Farm Safety Issues: "Issues/situations that contain most necessary conditions that could
lead to worker (onsite) or offsite radiation exposure through an uncontrolled release of fission products, e.g., Tank SY-101."

		Officially			Officially
Single-Shell Tanks		Added to	Double-Shell Tanks		Added to
Tank No.	Watch List	Watch List	Tank No.	Watch List	Watch List
A-101 (*)	Hydrogen	1/91	AN-103	Hydrogen	1/91
	Organics	5/94	AN-104	Hydrogen	1/91
AX-101	Hydrogen	1/91	AN-105	Hydrogen	1/91
AX-102	Organics	5/94	AW-101	Hydrogen	6/93
AX-103	Hydrogen	1/91	SY-101	Hydrogen	1/91
B-103	Organics	1/91	SY-103	Hydrogen	1/91
C-102	Organics	5/94	6 Tanks		
C-103	Organics	1/91			•
C-106	High Heat Load	1/91	TANKS BY WATCH	LIST	
S-102 (*)	Hydrogen,	1/91			
Ì	Organics	1/91	Hydrogen	Organics	. {
S-111 (*)	Hydrogen	1/91	A-101	A-101	
1	Organics	5/94	- AX-101	AX-102	
S-112	Hydrogen	1/91	AX-103	B-103	
SX-101	Hydrogen	1/91	S-102	C-102	A*
SX-102	Hydrogen	1/91	S-111	C-103	- !
(SX-103 (*)	Hydrogen	1/91	s-112	S-102	
1	Organics	5/94	SX-101	S-111	
SX-104	Hydrogen	1/91	SX-102	SX-103	
SX-105	Hydrogen	1/91	SX-103	SX-106	_
SX-106 (*)	Hydrogen,	1/91	SX-104	T-111	_
	Organics	1/91	SX-105	TX-105	
SX-109	Hydrogen because		SX-106	TX-118	
Ì	other tanks vent		SX-109	TY-104	
1	thru it	1/91	T-110	U-103	
T-110	Hydrogen	1/91	ัุบ-1ฺ03	U-105	
T-111 .	Organics	2/94	U-105	U-106	
TX-105	Organics	1/91	U-107	U-107	
TX-118	Organics	1/91	ju-108	U-111	
TY-104	Organics	5/94	U-109	U-203	
U-103 (*)	Hydrogen	1/91	AN-103	U-204	
	Organics	5/94	AN-104	20 Tanks	
U-105 (*)	Hydrogen	1/91	AN-105		-
	Organics	5/94	AW-101		
U-106	Organics	1/91	SY-101	High Heat	
U-107 (*)	Organics	1/91	SY-103	C-106	·
	Hydrogen	12/93	25 Tanks	1 Tank	- -
U-108	Hydrogen	1/91			
U-109	Hydrogen	1/91			
บ-111	Organics	8/93	32 Sin	gle-Shell tanks	
U-203	Organics	5/94	_6 Do	uble-Shell tanks	
U-204	Organics	5/94	38 Tar	nks on Watch Lis	ts
32 Tanks (*)			<u>L</u>		

^(*) Eight tanks are on more than one Watch List

All tanks were removed from the Ferrocyanide Watch List; see Table A-2, and A-3 (footnote #5)

TABLE A-2. ADDITIONS/DELETIONS TO WATCH LISTS BY YEAR

December 31, 1996

Added/Deleted dates may differ from dates that tanks were officially added to the Watch Lists. (See Table A-1).

		•					and the	SST	I CALL	ks (1)
1	Ferrocyan	ide	Hydr	ogen	Organ			55 I		
Y-240		A CONTRACTOR OF TAXABLE PARTY.	23		8	8.75.1997	1000		\$35.35 5	1
1 Original List Response to Public Law 101-510		-107				· · · · · · · · · · · · · · · · · · ·		1	2 / Silvin	53
Added 2/91 (revision to Original List)			23		8		0,000 1 0000	48	<u></u>	4
tal «December 31, 1991	90:0 44 (200	800000000000000000000000000000000000000	1	AW-101			1	- STATE	××6	52
Added 8/92			24				10.100	0,890	×200	********
Added 8/92 tal - December 31, 1992	(0,00,00 00 • (0,00,000)	******			1	Ú-111	1	۱ ۵	1 .	1
Added 3/93	4	-					1	~	}	l
Deleted 7/93) (s	3X-110)			<u> </u>		1		1	1
•		BX-111)			İ				i	1
		BY-101)			i]	ļ		1
) (T-101)		(U-107)			1	0		
Added 12/93		 	<u>1</u>	200000000000000000000000000000000000000	9	W W W W	2013	45	1 33 (1	5
viat - December 31, 1993	20		25	(4.0) (8.00	1	T-111		1		
Added 2/94		1			10	A-101	1	4	ş]	ł
Added 5/94	1	1				AX-102	-	1	1	1
Added 9/94						C-102	1	1	1	1
	1	ļ			ĺ	S-111	1		1	ļ
	1				1	SX-103	. [1	ì	-
	į.				1	TY-104	. [1	1	1
•	1	-			Ì	U-103			ì	1
	1				1	U-105		1	1	1
					1	U-203	1	Ì	1	1
	j				1	U-204		Ì	1	1
	1 ,	(BX-102)			Į.		1	'	2	1
Deleted 11/94		(BX-102)			-				200 20000	- L
	18.	(5)(-100)	25		20		2.004			6
ofal - December 31, 1994, & December 31, 1995	2 2 2 1 9 3 8 8 2 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	(C-108)	9000						-4	- (
Deleted 6/96	-	(C-109)	1		- 1		Ì	- [1	-
	- 1	(C-111)	İ				İ		1	ļ
		(C-112)	1				ĺ	_	12	ŀ
	-14	(BY-103)	ł		Ì		ì		·~[ì
Deleted 9/96	1	(BY-104)	ĺ		1		- [-	į	- 1
	i i	(BY-105)	1		1		İ	- 1	-	- 1
	1	(BY-106)	1			•	1	ı	ļ	1
		(BY-107)	İ					-		- 1
		(BY-108)			- 1		ļ	Į	-	
	1	(BY-110)			-			- [Į	
	ļ	(BY-111)	1		i		1	1	ļ	i i
	İ	(BY-112)	1				ł	1	İ	l l
	1	(T-107)			Į.		ļ	Į	1	
	1	(TX-118)			- {		-	ļ	1	1
	1	(TY-101)			1					
	1	(TY-103)			ł		İ	<u>.]</u>		
		(TY-104)	W 1000 N	400000000000000000000000000000000000000	2		3			6
Total - December 31, 1996	. 0		224 220 1	5	1.00 GW 165	garage garage	Acres 4			

⁽¹⁾ Eight tanks are on more than one list: A-101, S-102, S-111, SX-103, SX-106, U-103, U-105, and U-107; therefore the total of tanks added or deleted will depend upon whether a tank is also on another list.

TABLE A-3. TEMPERATURE MONITORING IN WATCH LIST TANKS (Sheet 1 of 2) December 31, 1996

All Watch List tanks are reviewed for increasing temperature trends. Temperatures in these tanks are monitored continuously by the Tank Monitor And Control System (TMACS), unless indicated otherwise.

Temperatures are taken in the waste unless in-waste thermocouples are out of service. See footnote (4) Temperatures below are the highest temperatures recorded in these tanks during this month, and do not exceed the maximum criteria limit for this month.

Temperatures in Degrees F. Total Waste in Inches

High Heat (5)(6) Hydro/Flammable Gas(4) **Organic Salts** Total Total Total Temp. Waste Temp. Waste Temp. Waste Tank No. Tank No. Tank No. 347 C-106 146 A-101 (*) 150 347 A-101 (*) 150 _72 1 Tank 76 14 AX-101 (*)(7) 133 272 AX-102 (*) AX-103 (*) 117 40 B-103 (*)(7) 63 17 S-102 106 207 C-102 83 149 66 S-111 C-103 118 91 224 207 S-112 85 239 S-102 106 224 SX-101 136 171 S-111 91 SX-102 SX-103 242 146 203 168 SX-103 SX-106 108 201 168 243 158 SX-104 164 229 T-111 64 SX-105 TX-105 (*) 228 174 254 99 SX-106 108 201 TX-118 74 134 SX-109 TY-104 65 24 148 96 T-110 U-103 86 166 63 133 U-103 87 166 U-105 91 147 U-105 78 91 147 U-106 81 U-107 166 80 143 U-107 80 U-108 U-111 115 88 166 82 U-109 U-203 63 6 84 164 AN-103 113 U-204 63 9

20 Tanks

All tanks have been removed from the Ferrocyanide Watch List. See footnote (5), and Table A-2.

See next page for footnotes

116

109

104

120

98

AN-104

AN-105

SY-101

SY-103

25 Tanks

AW-101 (*)

^(*) Temperatures in these eight tanks are taken manually on a weekly basis.

³⁸ Tanks are on the Watch List (8 tanks are on more than one list: A-101, S-102, S-111, SX-103, SX-106,U-103, U-105, U-107)

TABLE A-3. TEMPERATURE MONITORING IN WATCH LIST TANKS (sheet 2 of 2)

Footnotes:

Hydrogen/Flammable Gas:

Tanks which are suspected to have a significant potential for hydrogen/flammable gas generation, entrapment, and episodic release. There is a USQ associated with these tanks because of the potential consequences of a radiological release resulting from a flammable gas burn, an event not analyzed in the SST Safety Analysis Report (SAR).

Organic Salts:
Single-shell tanks containing concentrations of organic salts >3 weight% of total organic carbon (TOC)(equivalent to 10 wt% sodium acetate). Double-shell tanks have >3 weight% TOC but are not on the Watch List because they contain mostly liquid, and there is no credible organic safety concern for tanks which contain mostly liquid.

Tanks which contain heat generating strontium-rich studge and require drainable liquid to be maintained in the tank to promote cooling. Only tank C-106 is on the High Heat Watch List because in the event of a leak, without water additions the tank could exceed temperature limits resulting in unacceptable structural damage. The tank is cooled through evaporation in conjunction with active ventilation. Water is periodically added as evaporation takes place.

- Tank SX-109 has the potential for flammable gas accumulation only because other SX tanks vent (1) through it.
- Tank C-106 is on the Watch List because in the event of a leak without water additions the tank (2) could exceed temperature limits resulting in unacceptable structural damage.
- There are 15 single-shell tanks on active ventilation (eight are on the Watch List as indicated by (3) an asterisk):

C-105	sx-107
C-106 *	sx-108
SX-101 *	sx-109 *
sx-102 *	SX-110
SX-103 *	sx-111
SX-104 *	sx-112
SX-105 *	sx-114
sx-106 *	

Note: A-104, 105 and 106 exhauster has been out of service since 1991 and is no longer considered actively ventilated. Although C-104 has a cascade line with C-105, it is not considered to be actively ventilated.

- There are no in-waste temperatures for tanks AX-102 and B-103. The waste level in these tanks is (4) lower than the lowest thermocouple in these trees.
- Four tanks, C-108, C-109, C-111, and C-112, are classified SAFE, and were removed from the FeCN (5) Watch List per DOE-RL letter 96-WSD-116, dated June 25, 1996. The remaining 14 tanks were removed from the FeCN Watch List per DOE-RL letter 96-WSD-195, dated September 4, 1996.

TABLE A-4. TEMPERATURE MONITORING IN NON-WATCH LIST TANKS December 31, 1996

SINGLE-SHELL TANKS WITH HIGH HEAT LOADS (>40,000 Btu/hr)

Ten tanks have high heat loads for which temperature surveillance requirements are established by SD-WM-OSR-005 and OSD-T-151-00013. Only one of these tanks (241-C-106) is on the High Heat Watch List.

Temperatures in these tanks did not exceed OSR or OSD requirements for this month. All high heat load tanks with the exception of 241-A-104 and 241-A-105 are on active ventilation. All high heat load tanks are continuously monitored by the Tank Monitor and Control System (TMACS), with the exception of A-104 and A-105 which are taken manually, on a weekly basis.

	Temperature	Total Waste
Tank No.	(F.)	In Inches
A-104	186	10
A-105	137	07
C-106 (*)	146	72
SX-107	168	43
SX-108	191	37
SX-109	148	86
SX-110	166	28
SX-111	193	51
SX-112	150	39
SX-114 10 Tenks	184	71

(*) C-106 on High Heat Load Watch List

Highest temperature in 34 lateral thermocouples beneath A-105: 246

SINGLE SHELL TANKS WITH LOW HEAT LOADS (<= 40,000 Btu/hr)

差

There are 108 low heat load tanks; temperatures in tanks connected to TMACS are taken continuously Temperatures are manually taken semiannually in January and July in those tanks not yet connected to TMACS. All temperatures obtained were within historical ranges for the applicable tank. No temperatures have been obtained for several years in the tanks listed below. Most of these tanks have no thermocouple tree.

Tank No.	<u>Tank No.</u>
BX-104	TX-101
BY-102	TX-110
BY-109	TX-114
C-204	TX-116
SX-115	TX-117
T-102	U-104
T-105	

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS

149 TANKS (Sheet 1 of 6) December 31, 1996

The following table indicates whether Single-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month:

NOTE:

All Watch List and High Heat tank temperature monitoring is in compliance. (5) All Dome Elevation Survey monitoring is in

compliance. All Psychrometrics monitoring is in compliance. Drywell monitoring is done "as needed" In-tank photos/videos are taken "as needed"

	= in compliance with all applicable documentation = noncompliance with applicable documentation
N/C O/S	- Out of Service
Neutron	_ LOW readings taken by Neutron probe
POP	= Plant Operating Procedure TO-040-650 = Surface level measurement devices
MT/FIC/ ENRAF	
OSR	= Operational Safety Requirements, SD-WM-OSR-005 = Operating Specifications Doc., OSD-T-151-00013, -00031
OSD	 Operating Specifications Boss. Not applicable (not monitored, or no monitoring schedule)
N/A None	= Applicable equipment not installed

	Tank Category		Temperature	Primary Leak	Surfa	LOW Readings (OSD)(6,8)			
anƙ	Watch High		Readings	Detection	MT -	(OSR,OSD)	ENRAF	Neutron	
ank umber	List	Heat	(5)	Source (6)		None			
	37888 X (100	80.130 W.	18643838494	LOW	None		None	None	
101		70.000	化铁铁铁铁铁铁铁	None	None	None			
102	- Contract (1997)	0.000		LOW	Nane	None	632.635 23322335 775	Notre	
-103	0.0000000000000000000000000000000000000	x **	\$650,000 PA-1768	None	Моле	None	None	None	
-104	200000000000000000000000000000000000000	X 77	100000000000000000000000000000000000000	None	7000 OCT	None		None	
-105	300000000000000000000000000000000000000	3.760,278,384	130.048.00 P. 18	None	None	None	34 CONT. COM.	(fa)	
-106	- X	190725		LOW	None	None	None	None	
X-101	T x	100000000	m(m);m;m; 2 m; 2	None	alla alla alla alla alla alla alla all			None	
X-102	- - 	A 1000 000 000 000 000 000 000 000 000 0	2 Prisesse (1783/997), 31	None	None	None	\$ \$40 ps. 1 2 3 400 100 100 100 2 . Transit area to harder \$180600	None	
X-103	\$2000000 \chi_000000000000000000000000000000000000	10-20-20 20-22 20 Carros massandor		None	None	None		None	
X-104	200000000000000000000000000000000000000			None	None	A 300 000 A 100 000	None	None	
3-101	938989744	G 1000 : 6 10 20	01 10 20 20 20 20 20 20 20 20 20 20 20 20 20	ENRAF	None	None		0/6	
3-102	2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to 2000 to	22000	\$0 0.00000 0 11 000 0000 50 0.0000000 0 10 0000000000000000000000	None	None		None	000000000000000000000000000000000000000	
3-103	(%) X		93 DAMES (1966)	LOW	400000000000000000000000000000000000000	None	None		
3-104	0.000000	\$4.08 PM 1998		LOW		None	Frone	None	
B-105	2,870,770	n 8 promi	P (36,3882,626,627,72	FIC	None	8 71, ACCESSOR	None	22 Sycamor II	
B-106	100000000000000000000000000000000000000			None		None	None	None	
B-107				None	None		None	None	
B-108	4000000			None		None	None	None	
B-109				1	0.0000000000000000000000000000000000000	None	None		
B-110				LOW	None		None		
B-111				25	None	None		None	
B-112				ENRAF	1200 Y 1200 100 AVA 100 100 100 100 100 100 100 100 100 10	None	Hone	Nane	
B-201	a 15/50.50		M: 10000 300 417119	MT_	(38,38,773373344)	None	None	None	
B-202	10000000	n (10.000)		MT	20000000000000000000000000000000000000	None	None	None	
B-203	30.000		90. <i>96.00,000.</i> 7.278	MT	200220000000000000000000000000000000000	None	None	None	
B-204	2.89/03:3	30 9 800 800	20 (2000 pt) (2000 pt)	MT	None	None		None	
BX-101		70 (0.75)		ENRAF	O/S	None		None	
BX-102		19 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3 3		None	333300000	None		None	
BX-103		m 30000		ENRAF	None	None		None	
BX-103	3288	30 mm	None	ENRAF	None	None		None	
	200000000000000000000000000000000000000			None	None	None	9.03458983	None	
BX-105	#0000000000000000000000000000000000000	100 - 100 -	90 - 1289 (10,400)	ENRAF	Моле	gypox comorn		None	
BX-106 BX-107	\$20,900,200,200,200 20,000,000,000,000	93 - 20 1 - 20 2008 - 200 - 200 - 2		ENRAF	None	None	2. (c) 45 - 1485 3 - 1463 4 445	**************************************	

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 2 of 6)

	Tank Category		Temperature	Primary Leak	Surfac	ıs (1)	LOW Readings (OSD)(6,8) F Neutron	
	Watch High		Readings	Detection				
ank	List	Heat	(5)	Source (6)	TVI I	None None	5000 St 1000 1743	None :
umber	21842,5997, 165		STEEL STORY	None	O/S	None	13 (4 × 148) A	None
X-108	10 (00 kg 30 th 20 kg 20 ch		第一次对话的图像	None	None	None	1 3 3 3 3 3 3 3	None
X-109				None	OIS	None	VIII. A S C S A S	
X-110	3.0000000000000			LOW	O/S	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		None
X-111	6343333	and the second second second		ENRAF	None	None	None	
X-112	200 magain (and the comment that the control of		LOW	100 100 100 100 100 100 100 100 100 100	None	None	
Y-101	263532		None	LOW		None	None	
Y-102	1988	100 100 100 100 100 100	# 725 (1.39 (# 888)	LOW	270000000000000000000000000000000000000	None	2 22 30 3	
3Y-103	\$250 Page 1550		30.	LOW		None	None	
BY-104	\$49.83.80			LOW	100000000000000000000000000000000000000	None	None	
BY-105	1000 C 1000 C		. 220 2001000	LOW	CO. 3000000000000000000000000000000000000	None	None	
BY-106	100000			LOW		. Нопе	None	
BY-107	2000	362 KIPC (128%)	/30 (e. 1.2040)	None		None	None	None
BY-108	8:18:33:19:19			LOW	Nane		None	
BY-109	92840338	100 N 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	None	·	1802 40 50 00 5000	None	None,	
BY-110	30000			LOW	37.500000000	None	None	
BY-111	7,000,000,000	伊州局继接的首任 以		LOW	10 10 10 10 10 10 10 10 10 10 10 10 10 1	None	None	1.00
	70, 59 96 00 00 40 40 30 30 - 6		新疆 安静的基础	LOW	0.0073 (0.0074)	None	None	None
BY-112	23822000		The two courts of the second second	None	None	7 3370180800C	None	None
C-101	- 	Contract & Contract of the Association of			None	None	* * * * * * * * * * * * * * * * * * *	None
C-102	- X			ENRAF	5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	3 223 (28688888)	None	None
C-103	3000000	200 10 10 10 10 10 10 10 10 10 10 10 10 1	5 - 12 - 12 - 12 - 12 - 12 - 12 - 12 - 1	* None	None	None		None
C-104			1 5 2000 20	None	None		N 100 100 100 100 100 100 100 100 100 10	None
C-105				ENRAF	None	None	A Code (specially by	None
C-106 (4)	32.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.	and the control is say	**************************************	ENRAF	None		None	None
C-107	46000000			None	0,0000000	None	None	None
C-108	- 1888880		5 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	None	240000000000000000000000000000000000000	None	None	None
C-109	36,36,66,330,66	6 (100)	STREET, THE RESIDENCE	MT_	000,000,000	gares and annual services	None	None
C-110	1860/3060300	STEEL SELECTION		None None	300,000,000,000	None	7 A. W. W. W. W. W. W. W. W. W. W. W. W. W.	None
C-111	4 986000 500800000	000 m 20 m 20 m 20 m 20 m 20 m 20 m 20	Strain Company	Seed Mono	None	None	None.	None
C-112	363.30.30	8/18/04/19 19 Julié Julié 19/19/19/19 8/1989/80 1/19/19/19/19/19/19/19	888 D. J. W. 1985 MARK	Street Marian		111111111111	None	None
C-201	95350000	geografia (g. 1800-1919) geografia	20 Jan 2 Sec. 25 1983	None None	[2] 3/6/2002/20	None	None	None
C-202	33333333		0.000		6.5000000000000000000000000000000000000	None	None	None
C-203	(300000		None	None	(100 C 100 C	None		5 53 55 72 20 8
C-204	72000	1998 ST 10055 10088		ENRAF	None	None		
s-101	(A) (A) (A) (A) (A) (A) (A) (A) (A) (A)		20.000	ENRAF	None *	None	7 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
S-102	(////×			ENRAF	None	Мопв	01,000 0130-66330	
S-103	966.000	963888 D.G. 7 (2003)	77.75.7 1 20.30 4.30 4.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00 40.00	LOW	300000000000000000000000000000000000000	None	None	
S-104	31105779		387,55°. Y 7.2° 387.72	LOW	None	None	000000000000000000000000000000000000000	
S-105	38000	9 <i>6298</i> (4780) - 60	(4) (4) (4) (4) (4) (4) (4) (4) (4) (4)	ENRAF	None	None	ung (2000)	300 300 000 000 000 000 000 000 000 000
S-106	10001000000	Salar actions		ENRAF	1 (annual property of the Conference of the Conf	Могие	621 4000000	Nane
S-107	8833	17.50		LOW	o/s	None		
S-108	# 1 m	770 FE (200 80)		NS (1900)	None	None		
5-109		23333 Z (2011 P. V	COST TOP STORE	LOW	100000000000000000000000000000000000000	None		1000
S-110	- 1			N - (1.000)	1000 march 2000 M	None.	354 John 19	
S-111		x %333 (33.63 %)	793 (S. 1907)		200000000000000000000000000000000000000	None		
S-112	1 1 1 1 1 1 1 1 1	X		200 cm 2	100 N 100 N	None	的复数 网络多类	
SX-101	77 77 77 77 77 77 77 77 77 77 77 77 77	X TOTAL CONTRACT		LOW	2000000 2000000	2000 - 1 Total Control of the Contro		
SX-101		X *********			1000 0000 00 00 00 00 00 00 00 00 00 00	Marriage Control (Cartillian)	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
		X	\$	LOW	100000000000000000000000000000000000000		2000 1 A 100 40 10	9340 36 30 30 30 30
SX-103		x and a second		LOW		201 21 21 Sept 2 2 2 2		
SX-104		×	1876-51 700-0880	LOW	77 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7 7	Ver. 1 2 1 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	and the second s	
SX-105	Contract to	$\hat{\mathbf{x}}$	gagarorea Poulitz (1880)	ENRA	iF (2) (2) (3) (4) (5)		177	
SX-106			C88: 31 382 884	None	е 🤼	Constitution of the second		CONTROL CARCON CONTROL CONTROL
SX-107			X *****	Non	e //	Service Programme		

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 3 of 6)

	Tonk Category T		Primary Temperature Leak		Surfac	LOW Readings		
		Tank Category		Detection			(OSD)(6,8)	
enk	Watch	High Heat	Readings (5)	Source (6)	MT	FIC	ENRAF	Neutron
ımber	List			None		None	None	None
(-109 (4)	8888 X 5, 384	**************************************	17.34% no 1.1 18%	None	370000000000	None	None	Hone
ζ-110	10000000000000000000000000000000000000	33199 X 11344				None	None	None
(-111		X , 1	9.579826.25 (0.28%)	None	7. 124 FOR 18 25 1 1 2	None	None	None
(-112	diagnostica incorregioni		3 ** (\$5° m) h * (\$5°)	None	U4513 4 3 3 3 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	None	None	None
X-113				None	A7752080 GLad : 34	None	None	None
X-114	19 (8) (6 (2) (3)	800 800 X , 140.60		None	To the property of the second	None	None	None
X-115	\$5285 O52318		None	None	N. 1/100000000000000000000000000000000000		50 (CE # 000 B V.S.)	None
101	Agrega in agent 1995 in Reference (C. Sangaran et al.	GE WEEKE	TANK MERCHANIST	None	None		200	None
-102	10 876 DAY 10 V	CONTRACTOR OF THE PARTY OF THE	None	ENRAF	None	None	100000000000000000000000000000000000000	Mone
-103	309 84 WOOD 1 SE	gara gardakan)	"我想到我们的学	None	None None	None	* 7	19 3 3 3 5 3 5 18 8 6 3 8
-103	77.8	(% 18 50 18 3 9	10 M (16) (16)	LOW	380000000000000000000000000000000000000	None		None
	978386-000798-55	10 64347	None None	None	None	Мопв 💮	ericke britain	None
-105	95500000000000000000000000000000000000		a salata kalendari da AM	None	None	None	11975 188	
-106	SANCA BOLLLAN	30300	28.0 D22.03.2	ENRAF	None	None		None
-107	38000000000000	in recommendados.	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	ENRAF	None	None	an ang ang tang tang tang tang tang tang	None
-108	00000000000000000000000000000000000000	, arama jarundan jana Tahun basarin k		None	None	Nons	t fra garrista in	None
-109				LOW	None	None C	a many sample of	33333
-110	3.0.X		(*************************************	LOW	None	None		
-111	X			ENRAF	None	None	自己的 经银行股票	None
-112	3990 300 800 B	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			780 78 90,	None	None	None
-201	2000年 (日本)	stratian e		MT	2 - 30 (2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2 - 2	None	None	None
-202	(A) (A) (A) (A) (A) (A) (A) (A) (A) (A)		Branzier Getr	MT	15,50 2 - 0,701 - 0,000 1,000 - 0,000	None	None	None
-203	523539925	daniani		None	1300.00 (40 TO 10	None	None	None
-204		使 出版 100000000000000000000000000000000000	e Sandino edil	MT		None		None
TX-101	C2000 00 200 00	1366-6066	None	ENRAF	None	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		0 20 20 20 20
X-102	100 pt 100 100 100 100 100 100 100 100 100 10			LOW	OIS			None
X-103	8 500003 7500			None	None	0/6		Mone
TX-104	1021 J. 100	e Pasta Jili Jili	94 . MUUTTI Y 1900	None	None			
TX-105	×	e alaman mendir	建筑的	None	888888389	None		CONTROL PROMETOR
TX-106	\$852 SEC786			LOW		None		The confidence of the Confiden
TX-107	200.0 No. 200.0	e Presentation Pr	a and a firef	None	None	3/0/8	2 x 1 - 1 1 1 2 1 1 2 1 2 2 2 2 2 2 2 2 2 2	The agreement to the study.
		2 2 3 1000000000000000000000000000000000		None	None	O/S		
TX-108	98/14/5 (PT (C))			LOW	None	None		1. 0.0.1.3999
TX-109	\$78305908 3400			LOW	330V68833889 33.5C	None		
TX-110	39382038666	0.1.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.2.		0.	SAME LANGE	None		4 385000000
TX-111	938,738,500,500 X		# 3 to 4 to 5 1 1 1 1		860762333333333333	None	1 27 7 20 20 20 20 20 20 20 20 20 20 20 20 20	
TX-112	(1997年) (1916年)		realis en en en en en en en en en en en en en		100 G000 100 100 G00 G00 G00 G00 G00 G00	None	g Halles II.	5 9000000000000000000000000000000000000
TX-113	58,58468,48000	8/ 11/5-36/1 <u>1</u>	8 Part 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		10000000000000000000000000000000000000	None	3 1 7 333204	the state of the s
TX-114	3866 TO 1770		Hone	LOW	100 (0.00) 10 (0.00)	None		
TX-115					00000000000000000000000000000000000000	None	J. 4. 040 6. W	None
TX-116	327 338 335		None	None	0.0000000000000000000000000000000000000	None		Transmission
TX-117	38688310006	88 'Y L HWY'S	None 8	LOW				The second secon
TX-118	5200387368	()	SO ROYAL DA	LOW	None 3	None		None
TY-101	0000 100 000 000 000 000 000 000 000 00	20 24 MA NEX		None N	None			None
	300 NO 187		20 1 2 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		None		1 1 4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	(None.)
TY-102	**************************************			LOW	None		1	
TY-103	7,000,002,002				None			
TY-104			100		gg ors	None		
TY-105	2000 000 000 000 000 000 000 000 000 00				0/S	None		
TY-106	37 (19.30)				\$52,000,000,000,000,000,000,000,000,000,0			
U-101	1886			<u> </u>	None		No. Control of the	
U-102	(1)				None	10 1 10 10 10 march 1222 5 2000	dia in way basir'	
U-103	333803 X 033				7,000	2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	territoria de la compresa del compresa del compresa de la compresa del compresa de la compresa del compresa de la compresa del compresa de la compresa del compresa de la compresa del compresa del compresa del compresa de la compresa del compresa del compresa del compresa del compresa del compresa del comp	None
U-104	12764				None		1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
U-105	(() () (X () ()	sa industrii	k faltaarik	ENRAF			and the second second second second	
U-106	11.8% S. 3.27 X 24.5%	26 1 C. E. F. S.	en krajnja, il kraj	ENRAF	None	Sand House		

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS
149 TANKS (Sheet 4 of 6)

		Tank Category Temperature		Primary Leak		ce Level Readin	LOW Readings (OSD)(6,8)	
Tank	Watch	High	Readings	Detection	MT ((OSR,OSD)	ENRAF	Neutron
Number	List	Heat	(5)	Source (6)		None		KU 2000000000000000000000000000000000000
U-107	**************************************	7788888894231		ENRAF	None	None		
U-108	×			LOW	None	None		
U-109	X	1000000		ENRAF	None None	None		None
U-110				None	72.2.1.10	None		
U-111	X			LOW	None	None	None	None
U-112		78,200,000		None		None	None	Nane
U-201		1		MT		1	None	None
U-202				MT			None	None
บ-203	X (1)	S. 93388.6334.4		None	200000000000000000000000000000000000000	None	None	None
U-204	× X			MT	CA. 35 S. S. P. S. S. S. S. S.	None	THE PARTY OF THE P	W 300 (40 House of the
Catch Tanks a	nd Special Su				o i i nana se kasami ka	100000000000000000000000000000000000000	None	None
A-302-A	N/A	N/A	N/A"	90 to 2 170 to 1882	None	None	None	None
A-302-B	N/A	NIA	N/A	171		None		None
ER-311	NA	NIA	N/A	65 (71)	None	196000000000000000000000000000000000000	Morie,	None
AX-152	NIA	N/A	NIA	₹ 7 1.3.9		None:	None	None
AZ-151	N/A	N/A	NACCO	Principal (TO) Silver Life	None		None	
AZ-154	N/A	NIA	N/A	(77)		Nane	None	None
BX-TK/SMP	N/A	NIA	NHAV S	2 3 471 28 2		None	None	None
A-244 TK/SMP	NIA	N/A	N/A	37)	None	None	None	None
AR-204	N/A	NA	N/A	47)	7.0020000		None	None
A-417	N/A	NIA	N/A	47) 80	None	None	None	None
A-350	N/A	N/A	N/A	100 K 184 171 1860 186	None	None	#ione;	None
CR-003	N/A	NA	SEES N/A SCAR	171	None	None	None	None
Vent Sta.	N/A	N/A	N/A	1000 4718 85 4	A 600 10 10 10 10 10 10 10 10 10 10 10 10 1	None	None	None
S-302	N/A	NIA	NA NA	(35 S #7) (5 S. S. S.	None	None		None
S-302-A	N/A	N/A	DE N/A	(7) (7) (8) (8)	None		None	None None
S-304	NIA	NA	BILL, NIA	171.8 NO.	Nona		None	None
TX-302-B	N/A	N/A	N/A	17)		None	None	O/S
TX-302-C	N/A	NIA	N/A	475 (F75)	None	None	0.9000000000000000000000000000000000000	O/S
U-301-B	N/A	N/A	N/A	(7)	None	Моле		4
UX-302-A	NIA	N/A	N/A N/A	17)	None	None	1.1.00.25 5.05.000000	0 <i>i</i> s
S-141	NIA	NA	J. S. [N/A** All	170		None	None	None None
S-142	N/A	N/A	MA.	17)		None	None	Carlos Constitution of the
Totals:	32	10	N/C: 0		N/C: 0	N/C: 0	N/C: 0	N/C: O
149 tanks	Watch	High						
1	List	Heat					1	
	Tanks	Tanks				1	1	-
	(4)	(4)	1		<u>]</u>			

See Footnotes on next page

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 5 of 6)

Footnotes:

All SSTs have either manual tape, FIC, (or ENRAF), zip cord, or a combination of these surface level measuring devices.

ENRAF gauges are being installed to replace FICs, with the exception of C-106, which has both an ENRAF and an FIC. The ENRAF gauges are being connected to TMACS, but many are currently being read manually from the field. See Table A-7 for list of ENRAF installations.

- 2. High heat tanks have active exhausters; psychrometrics can be taken in the high heat tanks. Psychrometric readings are on an "as needed" basis with the exception of tanks C-105/106. Hanford Federal Facility Agreement and Consent Order," Washington State Department of Ecology, U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment 1994 (Tri-Party Agreement) requires psychrometric readings to be taken in C-105/106 on a monthly frequency.
- 3. In-tank photographs and videos are requested on an "as needed" basis.
- 4. Two tanks are on both category lists (C-106 and SX-109).
- 5. Temperature readings may be regulated by OSD or POP. Temperatures cannot be obtained in 13 low heat load tanks (see Table A-4). The OSD does not require readings or repair of out-of service thermocouples for the low heat load (≤40,000 Btu/h) tanks. However, the POP requires that attempts are to be made semiannually in January and July to obtain readings for these tanks.

Temperatures for many tanks are monitored continuously by TMACS; see Table A-8, TMACS Monitoring Status.

- 6. Document WHC-OSD-T-151-00031, "Operating Specifications for Tank Farm Leak Detection," requires that single-shell tanks with the surface level measurement device contacting liquid, partial liquid, or floating crust surface, will be monitored for leak detection on a daily basis. Tanks with a solid surface will be monitored for leak detection on a weekly basis by taking neutron scan data from a Liquid Observation Well (LOW), if an LOW is present. Tanks with a solid surface but without LOWs will not be monitored for leak detection if the tank has been interim stabilized, until an LOW is installed. Non-interim-stabilized tanks will have drywell surveys taken as a backup on a monthly basis if surface or interstitial level measurement equipment is unavailable. The OSD specifies what leak detection methods are to be used for each tank, and the requirements if the readings are not taken on the required frequency or if equipment is out of service.
- 7. Leak detection for the catch tanks is performed by monitoring for the buildup of liquid in the secondary containment (for most tanks with secondary containment) or for decrease in the liquid level for those tanks without secondary containment or secondary containment monitoring.

Tanks 240-S-302 and 241-S-302-A are monitored for intrusions only, and are not subject to leak detection monitoring requirements until liquid is present above the intrusion level.

Weight Time Factor is the surface level measuring device currently used in A-417, A-302-A, A-350 and 244-A-Tank/Sump. DCRT CR-003 is inactive and measured in gallons.

8. Document WHC-SD-WM-TI-605, REV. O, dated January 1994, describes the rationale for Liquid Observation Well (LOW) installation priority. This priority is based on tank leak status, tank surface condition, and tank stabilization status. Also included is a listing of tanks with the Waste level being below two feet which have no priority assigned because no effort will be made to install LOWs in the near future. LOW probes are unable to accurately monitor interstitial liquid levels less than two feet high.

Tanks which will not receive LOWs:

A-102	BX-101	C-201	T-106
A-104	BX-103	C-202	T-108
A-105	BX-105	C-204	T-109
AX-102	BX-106	SX-110	TX-107
AX-104	BX-108	SX-113	TY-102
B-102	C-108	SX-115	TY-104
B-103	C-109	T-102	TY-106
8-112	C-111	T-103	U-101
			U-112

Total - 33 Tanks

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 6 of 6)

- 9. TX-105 the riser has been removed; it has not been monitored since January 1987. Liquid levels are being taken.
- 10. All drywell scans are done by request only, when required in addition to, or as a BACKUP for, a PRIMARY leak detection method, per OSD-T-151-00031. Currently, there are only two tanks which require drywell scans (C-105 and C-106); these are taken monthly.

Only two tank farms, A and SX, have laterals. There are currently no functioning laterals and no plans to prepare these for use.

11. AX-101 - LOW reading taken by gamma rather than neutron sensor.

TABLE A-6. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS

28 TANKS (Sheet 1 of 2) December 31, 1996

The following table indicates whether Double-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the month indicated:

NOTE:

Dome Elevation Surveys are not required for DSTs.
Psychrometrics and in-tank photos/videos
are takne on an "as needed basis"

LEGEND:		÷	
(Shaded)	= in compliance with all applicable documentation		
N/C	= Noncompliance with applicable documentation		-
-357	= SD-WM-TI-357		
FIC/ENRAF	 Surface level measurement devices 		
M.T.			
OSR	= SD-WM-0SR-016, SD-WM-0SR-004	-	
osp	= OSD-T-151-0007	_	
None	= no M.T., FIC or ENRAF installed	_	
o/s	= Out of Service	_	
W.F.	= Weight Factor		
Rad.	= Radiation		

	Τ					Rad	liation Readings	
		Temperature Readings	Surfac	e Level Reading	gs (1)	Leak Detection	Annulus	
ank Jumber	Watch List	(3) (OSD)	M.T.	FIC	ENRAF	W.F.	Rad.	{-357)
	233800.88200.2834		1,702,897,089,08	None				72. N. N.
N-101 N-102		ASSESSED AND TRACK		6688888 XO	None			00000000000000000000000000000000000000
	X		4. 38 300 6	None			•	(90)
N-103	A CONTRACTOR OF THE PROPERTY OF THE PARTY OF	288.00000000000000000000000000000000000	O/S	None				
N-104	<u> </u>		ors	None	9,7,230,300,000			
N-105				and were corr	Note			444,900,000,000 Transportation
N-106 N-107	2010 2010 2010 2010 2010 2010 2010 2010		£ 750 80 80 80	100000000000000000000000000000000000000	None	28 25 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5	ors	1944 1984 1870 1800 1994 1986 1970
AP-101	8.386.200.300.300.300		2.070.000	18.12.1878/01.6688	None	≫ o/s	OIS	AC 1000 00000000000000000000000000000000
AP-102		3800 CO CO CO CO CO CO CO CO CO CO CO CO CO	1911 (BAN) (BAN)		None	ota		900 (00 (00 (00 (00 (00 (00 (00 (00 (00
AP-103	900000000000000000000000000000000000000	100-401020000000000000000000000000000000		SPECIAL CONTRACTOR	None	o/s	ors.	ggaet (* 11 processor) og 1 10 september 1981 i 1981 e
AP-104	20000000000000000000000000000000000000	2000 200 1000 PM 1000 PM	0/\$	90003800079366	None	O/S	0/5	en tellenget till i. Sommeternisklike
AP-104 AP-105	2.200.000.000.000		11. Yestiz: 131.72		None	* CO/S	O/S	2000/00/00/00 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 600 p. 60
	100000000000000000000000000000000000000	2000	(1.00 (1.00	2000000000	None	O/S	O/S	gradia de la Colonia. Massacción de la Colonia
AP-106			Charanal Ciril	838 3337538	None	gy ors	O/S	68483000 1130 P
AP-107	355538800000000000000000000000000000000		122000000		None	0/5	0/8	88.00886083.
AP-108	2002000000000000000000000000000000000	1 000 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	2.23/97/2016/0	None			O/S	(3.5 k 0.0 to 10.0 to
AW-101	×			1. m. 2000 11 (1. m.)	[6]		0/S	
AW-102	(40.30), (7.51), (1.50), (2.50)		02.8198333	None	(0.000)		⇒o/s	
AW-103	0.000 300 300 300 300 300 300 300 300 30	3336 888 888 888 888 888 888 888 888 888	4.24.8333	None		239.289 Ci.	0/5	<i>22339</i> 4
AW-104	60 200 11 10 10 10 10 10 10 10 10 10 10 10 1	1 000 00 0 0000 0 000 0 0000 0 0000 0 0000		None	300 and 100 and 100 and 100 and 100 and 100 and 100 and 100 and 100 and 100 and 100 and 100 and 100 and 100 an		O/S	
AW-105		300 1.000 20 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	. ACM 88 88	> None		\$16KG 27KB 17KB	OIS	(5/8/10/19/10/
AW-106			rse audicean	None		pictorapes (al	ors	,5 [5]
AY-101	3797350300 (30.003345)	**************************************	7877803	48 (CONT.)	None			(5)
AY-102	ESSESSES (2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/2003/1/20	4 00 00 00 00 00 00 00 00 00 00 00 00 00	O/S	None	1.55 (AM) SP 1.70%			(5)
AZ-101	2000 100 100 100 100 100 100 100 100 100	100000000000000000000000000000000000000	A. 100 1999	19-83-090380036	None			351
AZ-102	×	1	o/s	2000 2000 2000	80.000.000		(7)	
sY-101	(2000) (A. A. A. A. A. A. A. A. A. A. A. A. A. A	, <u>1</u> 2000 (100 (170 (170 (170 (170 (170 (170 (None	19:00	20000C3n938		015033555
SY-102			0/\$	None			(7)	\$79,480,679
SY-103	×			- 000000000 - 100 A 1100	N/C: o	N/C: 0	N/C: 0	N/C: 0
Totals:	6	N/C: 0	N/C: 0	N/C: 0	IN/U: 0	[5.	1	·
28 tanks	Watch List Tanks	: 1		l	<u> </u>			

See footnotes next page.

TABLE A-6. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS 28 TANKS (Sheet 2 of 2)

Footnotes:

- All DSTs have both FIC and manual tape which is used when the FIC is out of service. N/C will be shown when no readings are obtained. ENRAF gauges are being installed to replace FICs. The ENRAF gauges are being connected to TMACS, but some are currently being read manually.
- 2. Psychrometric readings are taken on an "as needed" basis. Currently, monthly readings are being taken on the SY-101, SY-102, and SY-103 tank exhaust. No other psychrometric readings are currently being taken.
- OSD specifies DST temperature limits, gradients, etc.
- 4. Failure of both leak detection systems requires repair of at least one system within 5 working days. Failure of one system only, repair must be within 10 workdays per -357 document. If the repair of out-of-service system exceeds these timeframes, all systems are N/C. Out-of-service systems which have not exceeded these timeframes will be shown as O/S.
- 5. AY-101/102 and AZ-101/102 annulus are now monitored by an Annulus Leak Detection Probe Measurement rather than the annulus CAM.
- 6. AW-102 has ENRAF, FIC and M.T. At some point the FIC will be removed.
- 7. SY-101 and SY-103 had intermittent RAD readings due to power problems.

TABLE A-7. ENRAF SURFACE LEVEL GAUGE INSTALLATION AND DATA INPUT METHODS

December 31, 1996

						Decemb								
EGEND					d Surveillanc									_=
	SACS	= Surveilla	nc	e Analysi	s Computer S	ystem								
	TMACS	CS = Tank Monitor and Control System = Automatically entered into TMACS and electronically transmitted to SACS												
·	Auto	= Automa	tica	ally enter	ed into TMAC	S and elec	tro	nically tra	ensmitted to	SACS				
•	Manual	= EITHER	ma	nually en	tered into CA	SS by field	ор	erators a	nd electronic	ally transmit	ed	to SACS	;	_
		OR manu	ıail	y entered	directly into	SACS by s	urv	eillance p	ersonnet, fro	m Field Data	sh	eets		
											-	-		
EAST A	AREA							WEST	AREA			-		
	T			Tomle	Installed	Innut			Installed	Input		Tank	installed	Input
Tank	Installed	Input		Tank	Installed	Input		Tank		· ·			i	1 '
No.	Date	Method		No.	Date	Method		No.	Date	Method		No.	Date	Method
A-101	09/95	Manual		B-201				S-101	02/95	Manual		TX-101	11/95	Auto
A-102				B-202				S-102	05/95	Manuzi	444	TX-102	05/96	Auto
A-103	07/96	Manual		B-203				S-103	05/94	Auto		TX-103	12/95	Auto
A-104	05/96	Manual		B-204			m	5-104				TX-104	03/96	Auto
A-105	<u> </u>			BX-101	04/96	Auto		S-105	07/95	Manual		TX-105	04/96	
A-106	01/96	Manual		BX-102	06/96	Auto	<u> </u>	S-106	06/94	Auto		TX-106	04/96	Auto
AN-101	08/96	Manual		BX-103	04/96	Auto		S-107	06/94	Auto		TX-107	04/96	Auto
AN-102				BX-104	05/96	Auto		S-108	07/95	Manual		TX-108	04/96	Auto
AN-103	08/95	Manual		BX-105	03/96	Auto		S-109	08/95	Manual		TX-109	11/95	Auto
AN-104	08/95	Manual	×	BX-106	07/94	Auto		S-110	08/95	Manual		TX-110	05/96	Auto
AN-105	08/95	Manual	×	BX-107	06/96	Auto	M	S-111	08/94	Auto	1	TX-111	05/96	Auto
AN-106				BX-108	05/96	Auto	88	S-112	05/95	Manuai	W	TX-112	05/96	Auto
AN-107				BX-109	08/95	Auto	188	SX-101	04/95	Manual		TX-113	05/96	Auto
AP-101				BX-110	06/96	Auto		SX-102	04/95	Manual		TX-114	05/96	Auto
AP-102				BX-111	05/96	Auto		SX-103	04/95	Manual	88	TX-115	05/96	Auto
AP-103			100	BX-112	03/96	Auto		SX-104	05/95	Manual	188	TX-116	05/96	Auto
AP-104				BY-101	<u> </u>	<u> </u>		SX-105	05/95	Manual	133	TX-117	06/96	Auto
AP-105	1			BY-102	<u> </u>			SX-106	08/94	Auto	1888	TX-118	03/96	Auto
AP-106	T	T		BY-103		l		SX-107	<u> </u>	<u> </u>		TY-101	07/95	Auto
AP-107				BY-104		ļ		SX-108	<u> </u>	<u> </u>		TY-102	09/95	Auto
AP-108				BY-105		ļ		SX-109	<u> </u>	 		TY-103	09/95	Auto
AW-101	08/95	Manual	88	BY-106	<u> </u>	 		SX-110		ļ	133	TY-104	06/95	Auto
AW-102	05/96	Manual		BY-107	<u> </u>	<u> </u>		SX-111	ļ	 	- 123	TY-105	12/95	Auto
AW-103	05/96	Manual	38	BY-108	<u> </u>		128	SX-112	<u> </u>	 	33	TY-106	12/95	Auto
AW-104	01/96	Manual		BY-109	ļ	<u> </u>		SX-113	<u> </u>	 	188	U-101	 	
AW-105	06/96	Manuai		BY-110	<u> </u>	<u> </u>	188	5X-114	<u> </u>	 	- 88	U-102	01/96	Manual
AW-106	06/96	Manual	188	BY-111	<u> </u>	 		SX-115	\	ļ	833	U-103	07/94	Auto
AX-101	09/95	Manual		BY-112		 	188	SY-101	07/94	Auto	- 33	U-104	07/04	
AX-102	1	<u> </u>		C-101		 		SY-102	06/94	Manual	1883	U-105	07/94	Auto
AX-103	09/95	Manual		C-102	 	ļ	13	SY-103	07/94	Manual		U-106	08/94	Auto
AX-104	10/96	Manual		C-103	08/94	Auto	- [4	T-101	05/95	Manual	188	U-107	08/94	Auto
AY-101	03/96	Manual	羉	C-104	<u> </u>	1	_	T-102	06/94	Auto	8	U-108	05/95	Manual
AY-102				C-105	05/96	Manual		T-103	07/95	Manual	33	U-109	07/94	Auto
AZ-101	08/96	Manual		C-106	02/96	Auto	18	T-104	12/95	Manual	- 133	U-110	01/96	Manual Manual
AZ-102				C-107	04/95	Auto	- 100	T-105	07/95	Manual	8	U-111	01/96	wannai
B-101				C-108		 	100	T-106	07/95	Manual	- 199	U-112	+	
B-102	02/95	Manual		C-109	 		-18	T-107	06/94	Auto	- 100	U-201	- 	-
B-103		 		C-110	 	 	-18	T-108	10/95	Manual	188	U-202	╂┈┈╌╌	
B-104		 	8	C-111		 	-13	T-109	09/94	Manual	- 1888 - 1888	U-203 U-204		+
B-105		 		C-112	03/96	Manual	188	T-110	05/95	Manual Manual	- 1993 1993	8 0-204		
B-106		 _		C-201	 	 		T-111	07/95		88	일	+	
B-107			_	C-202	 	 	-12	T-112	09/95	Manual	- 128 128	8 9		
B-108	<u> </u>	<u> </u>	, 🔯	C-203	 	<u> </u>	-13	T-201	 	 	100 100		 	
B-109				C-204		_	42	T-202	 	-	- 123	<u> </u>		- -
B-110		<u> </u>	×	¥		_	-13	T-203	ļ		-8	23		
B-111			3				- 13	T-204	 		- 18	9		
		1	1.23	631	1	r	100	55 4		•	430	.v∉	-	1
B-112	03/95	Manual	- 133	8	1	_1	_]*	8.	<u>l</u>	1	- 8	<u> </u>	<u>l</u>	

103 ENRAFs installed: 52 automatically entered into TMACS, 51 are manually entered into CASS.

TABLE A-8. TANK MONITOR AND CONTROL SYSTEM (TMACS) December 31, 1996

Note: Acceptance Testing has been completed on the following sensors

Sensors Automatically Monitored by TMACS

<u> </u>	Tempera			intoled by TN		
		Resistance		Ì	1.	
EAST AREA	Thermocouple	Thermal	ENRAF			Gas
	Tree	Device	Level	1	1	Sample
Tank Farm	(TC)	(RTD)	Gauge	Pressure	Hydrogen	Flow
A-Farm (6 Tanks)	 				1,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	
AN-Farm (7 Tanks)	7			7		
AP-Farm (8 Tanks)				 	··	
AW-Farm (6 Tanks)	 				 	
AX-Farm (4 Tanks)	 			 		
AY-Farm (2 Tanks)						······································
AZ-Farm (2 Tanks)	 			 	 	
B-Farm (16 Tanks)	 				1	
BX-Farm (12 Tanks)	11		12	 		
BY-Farm (12 Tanks)	10	3	·	-		
C-Farm (16 Tanks)	15	1	3	1		· · · · · · · · · · · · · · · · · · ·
TOTAL EAST AREA						
(91 Tanks)	43	4	15	8	0	0
WEST AREA						
S-Farm (12 Tanks)	12		4		3	3
SX-Farm (15 Tanks)	14		1		7	7
SY-Farm (3 Tanks)	3		1	1	2	1
T-Farm (16 Tanks)	14	1	2			
TX-Farm (18 Tanks)	14	1	18		<u> </u>	
TY-Farm (6 Tanks)	6	3	6			
U-Farm (16 Tanks)	15	<u> </u>	5	<u> </u>	5	5
TOTAL WEST AREA				J]	
(86 Tanks)	82	4	37	1	17	16
TOTALS (177 Tanks)	121	8	52	9(ь)	17(c)	19(a)

⁽a) Tank SY-101 has 2 gas sample flow sensors plus 2 vent flow sensors.

⁽b) Each tank has low and high range sensors (9x2 = 18 sensors)

⁽c) Each tank has low and high range sensors (17x2=34 sensors)

APPENDIX B

DOUBLE SHELL TANK WASTE TYPE AND SPACE ALLOCATION

TABLE B-1. DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION NOVEMBER 1996

DOUBLE-SHELL TANK INV	ENTORY BY WASTE TYPE	SPACE DESIGNATED FOR SPE	CIFIC USE
Complexed Waste (102-AN, 106-AN, 107-AN, 101-SY, 103-SY, (101-AY , 108-AP (DC))	4.52 Mgai	Spare Tanks (3) (1 Aging & 1 Non-Aging Waste Tank)	2.28 Mgaf
Concentrated Phosphate Waste (102-AP)	1.1 Mgal	Watch List Tank Space (103-AN, 104-AN, 105-AN, 101-SY, 103-SY,	0.71 Mgal 101-AW)
Double-Shell Slurry and Slurry Feed (103-AN, 104-AN, 105-AN, 101-AP, 101-AW, 106-AW)	4.69 Mgat	Segregated Tank Space (102-AN, 106-AN, 107-AN, 102-AP, 108-AP, 101-AZ, 102-AZ)	2:23 Mgal 101-AY
Aging Waste (NCAW) at 5M Na Dilute in Aging Tanks (101-AZ, 102-AZ)	1,22 Mgai 0,24 Mgai	Receiver/Operational Tank Space (2) (101-AN, 106-AP, 102-SY, 102-AW, 106-AV	\$:56 Mgai /)
Dilute Waste (1) (101-AN, 103-AP, 105-AP, 106-AP, 10 102-AW, 103-AW, 104-AW, 105-AW, 102-AY, 102-SY, 104-AP)	3.9.Mgal . 7-AP,	Total Specific Use Space (12/31/96)	878 Mgal
•		TOTAL DOUBLE-SHELL TANK S	PACE
NCRW, PFP and DST Settled Solids (All DST's)	3,22 Mgal	24 Tanks at 1140 Kgal 4 Tanks at 980 Kgal	27 36 Mgat 3.82 Mgat 31.28 Mgat
Tofat hiventory	19.09 Mgal	Total Available Space Double-Shell Tank Inventory Space Designated for Specific Use Remaining Unallocated Space	31.28 Mgat 19.09 Mgat 8.78 Mgat 3.41 Mgat

⁽¹⁾ Was reduced in volume by -0.0 Mgal this month (Evaporator WVR)

Note: Net change in total DST inventory since last month: +0.005 Mgal

WVPTOT

⁽²⁾ Tank Space Reduced by Facility Generations and Saltwell Liquid pumping

^{(3) 241-101-}AY: A minumum liquid level is set to provide extra protection against any bottom uplifting of the tank's steel liner. Because of space availablility, waste is stored in 102-AY, the aging waste spare tank. In case of a leak the contents of 102-AY will be distributed to any other DST(s) having available space.

Table B-2. Double Shell Tank Waste Inventory for December 31, 1996

TÄNKS	INVENTORY	SOLIDS	TYPE	LEFT
101AW=	1128	84	DSSF	12
102AW=	99	33	DN	1041
103AW=	513	363	NCRW	627
104AW=	1120	267	DN	20
105AW=	439	286	NCRW	701
106AW≃	320	224	DSSF	820
101AY=	913	94	DC	67
102AY=	837	30	DN	143
101AZ=	883	35	NCAW	97
102AZ=	913	95	NCAW	67
101AN=	117	33	DN	1023
102AN=	1076	89	CC	64
103AN≖	956	373	DSS	184
104AN=	1056	264	DSSF	84
105AN≔	1128	Ó	DSSF	12
106AN=	416	17	CC	724
107AN=	1055	247	CC	85
101SY=	1116	41	CC	24
102SY=	610	123	DN/PT	530
103SY=	741	362	CC	399
101AP=	1042	0	DSSF	98
102AP=	1096	0	CP	44
103AP=	22	1	DN	1118
104AP=	26	0	DN	1114
105AP=	1122	154	DN	18
106AP≂	270	0	DN	870
107AP=	20	0	DN	1120
108AP=	56	0	DC	1084
TOTAL=	19090		TOTAL=	12190

MOTE, Solids Adjusted	10 10	1036	Collette Matteric Dam

TOTAL DST SPACE	AVAILABLE
NON-AGING =	27360
AGING ≃	3920
TOTAL	\$0% (m) 31280

DST INVENTORY	CHANGE
11/96 TOTAL .	19085
12/96 TOTAL	19090
INCREASE	5

WATCH LIST SPAC	E
101AW=	12
101SY=	24
103SY=	399
103AN=	184
104AN=	84
105AN=	12
TOTAL=	716
SEGREGATED SPACE (DC.	
102AP=	44
108AP=	1084
101AY=	67
102AN=	64
106AN≖	724
107AN=	85
101AZ=	97
102AZ=	67
TOTAL	2232
WASTE RECEIVER SP	
101AN (200E/DC)=	1023
102SY (200W/DN)=	530
106AP (200E/DN)=	870

USABLE SPACE	
101AP≃	\$8
103AP=	1118
104AP=	1114
105AP=	18
107AP=	1120
102AW=	1041
103AW=	627
104AW=	20
105AW= -	701
106AW=	820
102AY=	143
TOTAL=	6820
EVAP. OPERATIONS	-1140
SPARE SPACE	-2280
USABLE LEFT=	3400
	' #*

USABLE SPACE CHANGE		
11/96 TOTAL SPACE	3395	
12/96 TOTAL SPACE	3400	
INCREASE≅		

WASTE RECEIVER SPAC	E CHANGE
11/96 TOTAL SPACE	2423
12/96 TOTAL SPACE	2423
CHANGE	0

Inventory Calculation by Waste Type:

C	OMPLEXED WASTE	
102AN=	987 (CC)	
106AN=	399 (CC)	
107AN=	808 (CC)	
101SY=	1075 (CC)	
103SY=	379 (CC)	
101AY=	819 (DC)	
108AP=	56 (DC)	
TOTAL=	4523	

103AW=	363	
105AW=	286	

	PFP SOLIDS (P	T) .
102SY=	123	
TOTAL	123	

C	ONCENTRATED	PHOSPHATE (CP)
102AP=	1096	
TOTALE	1096	

DILUTE WAS	TE (DN)
103AP=	21
104AP=	26
105AP=	968
106AP=	270
107AP=	20
101AN=	84
102AW=	6 6
103AW=	150
104AW=	853
105AW=	153
102AY=	807
102SY=	487
TOTAL#	3905

NCAW (AGING (@ 5M Na	*
101AZ=	791
102AZ=	434
AT 5M Na= DN=	1225 441
TOTAL	1666

DSS/DSS	iF
101AP=	1042
103AN=	583
104AN=	792
105AN= ' -	1128
101AW=	1044
106AW=	96
TOTAL=	4685

G	RAND TOTALS	
CC=		3648
DC=	-	875
NCRW SOLI	DS=	649
DST SOLIDS	<u>;=</u>	2313
PFP SOLIDS	;= ⁻	123
AGING SOLI	DS=	130
CP=		1096
NCAW=		1666
DSS/DSSF=		4685
DILUTE=		3905
TOTAL		19090

INV1296

Table B-2. Double Shell Tank Waste Inventory for December 31, 1996

TO THE NAME OF A	ACE AS O	F DECEMBER 31, 1996	: 12190 KGAL
WATCH LIST TANK SPACE:	TANK	WASTE TYPE	AVAILABLE SPACE
Inusable DST Headspace - Due to Special Restrictions	101-AW	DSSF	12 KGALS
Placed on the Tanks, as Stated in the "Wyden Bill"	101-SY	CC	Ź4 KGALS
	103-SY	CC	399 KGALS
	103-AN	DSS	184 KGALS
	104-AN	DSSF	84 KGALS
	105-AN	DSSF	12 KGALS
		TOTA	L= 715 KGALS
		AVAILABLE TANK SPACE=	12190 KGALS
TOTAL AVAILABLE SPACE AF	*******************	NUS WATCH LIST SPACE:	
	COMMON A MAN AND MAN AND A 19 17	e a non la companion de la com	— Asuntousedouropeuro un bioto (Son (1797) (1997) i
EGREGATED TANK SPACE:	TANK	WASTE TYPE	AVAILABLE SPACE
DST Headspace Available to Store Only Specific Waste Typ		CP	44 KGALS
	108-AP	DC	1084 KGALS
	101-AY	DC	67 KGALS
	102-AN	CC	64 KGALS
	106-AN	CC	724 KGALS
	107-AN	CC	85 KGALS
	101-AZ-	AW	97 KGALS
	102-AZ	AW	67 KGALS
		TOTA	L= 2232 KGALS
AVAILABLE SP.	ACE AFTER V	WATCH LIST DEDUCTIONS	= 11475 KGALS
		JS SEGREGATED SPACE=	
TOTAL AVAILABLE SPACE AFTE	.,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	HED SPACE DEDUCTIONS	S≝ 9243 KGALS
SABLE/WASTE RECEIVER TANK SPACE:	TANK	WASTE TYPE	AVAILABLE SPACE
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated	TANK 101-AP	WASTE TYPE DSSF	AVAILABLE SPACE 98 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated	TANK 101-AP 103-AP	WASTE TYPE DSSF DN	AVAILABLE SPACE 98 KGALS 1118 KGALS
SABLE/WASTE RECEIVER TANK SPACE: THeadspace Available to Store Facility Generated	TANK 101-AP 103-AP 104-AP	WASTE TYPE DSSF DN DN	AVAILABLE SPACE 98 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste	TANK 101-AP 103-AP	WASTE TYPE DSSF DN	AVAILABLE SPACE 98 KGALS 1118 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated	TANK 101-AP 103-AP 104-AP	WASTE TYPE DSSF DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP	WASTE TYPE DSSF DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated Id Evaporator Product Waste	TANK 101-AP 103-AP 104-AP 105-AP 106-AP	WASTE TYPE DSSF DN DN DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW	WASTE TYPE DSSF DN DN DN DN DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW	WASTE TYPE DSSF DN DN DN DN DN DN DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS
SABLE/WASTE RECEIVER TANK SPACE: 67 Headspace Available to Store Facility Generated of Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW	WASTE TYPE DSSF DN DN DN DN DN DN DN DN NCRW	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS
SABLE/WASTE RECEIVER TANK SPACE: 67 Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK EVAPORATOR RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 104-AW	WASTE TYPE DSSF DN DN DN DN DN DN DN DN DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS
SABLE/WASTE RECEIVER TANK SPACE: 6T Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 104-AW 105-AW	WASTE TYPE DSSF DN DN DN DN DN DN DN DN DN DN NCRW DN NCRW	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS 701 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK EVAPORATOR RECEIVER TANK FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 104-AW 105-AW	WASTE TYPE DSSF DN DN DN DN DN DN DN DN NCRW DN NCRW DN NCRW DSSF	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS 701 KGALS 820 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK EVAPORATOR RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 105-AW 106-AW 101-AN 102-AY 102-SY	WASTE TYPE DSSF DN DN DN DN DN NCRW DN NCRW DN NCRW DSSF DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS 701 KGALS 820 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK EVAPORATOR RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 105-AW 106-AW 101-AN 102-AY 102-SY	WASTE TYPE DSSF DN DN DN DN DN DN NCRW DN NCRW DSSF DN DN	98 KGALS 1118 KGALS 1114 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS 701 KGALS 701 KGALS 1023 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK EVAPORATOR RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 104-AW 105-AW 101-AN 102-AY 102-SY	WASTE TYPE DSSF DN DN DN DN DN NCRW DN NCRW DN NCRW DSSF DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS 701 KGALS 820 KGALS 1023 KGALS 143 KGALS 530 KGALS
SABLE/WASTE RECEIVER TANK SPACE: ST Headspace Available to Store Facility Generated and Evaporator Product Waste FACILITY WASTE RECEIVER TANK EVAPORATOR FEED TANK EVAPORATOR RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK FACILITY WASTE RECEIVER TANK	TANK 101-AP 103-AP 104-AP 105-AP 106-AP 107-AP 102-AW 103-AW 104-AW 105-AW 101-AN 102-AY 102-SY	WASTE TYPE DSSF DN DN DN DN DN NCRW DN NCRW DN NCRW DSSF DN DN DN	AVAILABLE SPACE 98 KGALS 1118 KGALS 1114 KGALS 18 KGALS 870 KGALS 1120 KGALS 1041 KGALS 627 KGALS 20 KGALS 701 KGALS 820 KGALS 1023 KGALS 143 KGALS 530 KGALS

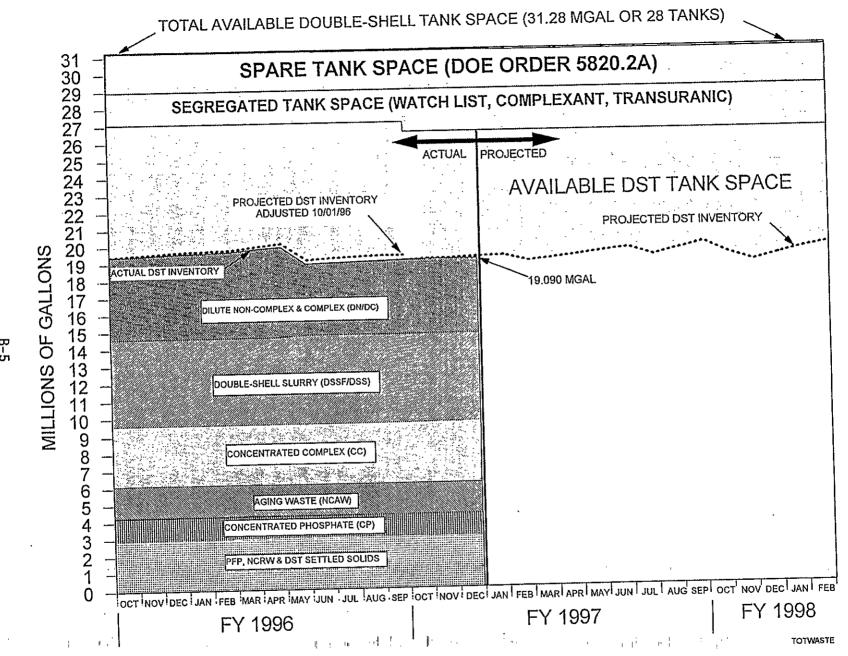


FIGURE B-1. TOTAL DOUBLE-SHELL TANK INVENTORY

This page intentially left blank

APPENDIX C

TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS

C. TANK AND EQUIPMENT CODE/STATUS DEFINITIONS December 31, 1996

1. TANK STATUS CODES

WASTE TYPE (also see definitions, section 3)

AGING Aging Waste (Neutralized Current Acid Waste [NCAW])

Complexant Concentrate Waste

Concentrated Phosphate Waste CP

Dilute Complexed Waste DC Dilute Non-Complexed Waste

Double-Shell Slurry Double-Shell Slurry Feed DSS

DSSE

NCPLX Non-Complexed Waste

PD/PN Plutonium-Uranium Extraction (PUREX) Neutralized Cladding

Removal Waste (NCRW), transuranic waste (TRU)

Plutonium Finishing Plant (PFP) TRU Solids

TANK USE (DOUBLE-SHELL TANKS ONLY)

Concentrated Waste Holding Tank

DRCVR Dilute Receiver Tank

EVFD Evaporate Feed Tank

SRCVR Slurry Receiver Tank

SOLID AND LIQUID VOLUME DETERMINATION METHODS

- Food Instrument Company (FIC) Automatic Surface Level Gauge
- ENRAF Surface Level Gauge (being installed to replace FICs) E
- М Manual Tape Surface Level Gauge
- Photo Evaluation
- Sludge Level Measurement Device

DEFINITIONS

WASTE TANKS - GENERAL

Waste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition.

けるで かなるながら かんとうない

Watch List Tank

An underground storage tank containing waste that requires special safety precautions because it may have a serious potential for release of high level radioactive waste because of uncontrolled increases in temperature or pressure. Special restrictions have been placed on these tanks by "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5, 1990, Public Law 101-510, (also known as the Wyden Amendment).

Characterization

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to insure safe storage and interim operation, and ultimate disposition of the waste.

WASTE TYPES

Aging Waste (AGING)

High level, first cycle solvent extraction waste from the PUREX plant (NCAW)

Concentrated Complexant (CC)
Concentrated product from the evaporation of dilute complexed waste.

Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste.

Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants:

HNF-FP-0182-105

ethylenediaminetetra-acetic acid (EDTA), citric acid, and hydroxyethylethylenediaminetriacetic acid (HEDTA), being the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs).

Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from T and S Plants, the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes), 100 N Area (sulfate waste), B Plant, saltwells, and PFP (supernate).

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

Double-Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. This form is not as concentrated as DSS.

Non-complexed (NCPLX)

General waste term applied to all Hanford Site (NCPLX) liquors not identified as complexed.

PUREX Decladding (PD)

PUREX Neutralized Cladding Removal Waste (NCRW) is the solids portion of the PUREX plant neutralized cladding removal waste stream; received in Tank Farms as a sturry. NCRW solids_ are classified as transuranic (TRU) waste.

PFP TRU Solids (PT)
TRU solids fraction from PFP Plant operations.

<u>Drainable Interstitial Liquid (DIL)</u>
Interstitial liquid that is not held in place by capillary forces, and will therefore migrate or move by gravity. (See also Section 4)

The liquid above the solids in waste storage tanks. (See also Section 4)

A compound of iron and cyanide commonly expressed as FeCN. The actual formula for the ferrocyanide anion is [Fe(CN),]

INTERIM STABILIZATION (Single-Shell Tanks only)

Interim Stabilized (IS)

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant liquid. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow must also have been at or below 0.05 gpm before interim stabilization criteria is met.

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down-hole jet assembly, 3) flexible or rigid transfer jumpers, 4) a flush line, and 5) a flowmeter. The jumpers contain piping, valves, and pressure and limit switches.

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber. The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle, lifting power fluid, and interstitial liquid to the pump pit. Pumping rates vary from 0.05 gallons to about 4 gpm.

Saltwell Screen

The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel ine sattwelt system is a 10-inch diameter sattwelt casing consisting of a stainless steet saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank. The saltwell screen portion of the casing is an approximately 10-foot length of 300 Series, 10-inch diameter, stainless steel pipe with screen openings (slots) of 0.05 inches. Emergency Pumping Trailer

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment: this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skidmounted Weight Factor Instrument Enclosure (WFIE) with an air compressor and electronic recording instruments. The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation. A rack for over 100 feet of overground double-contained piping is also in the trailer.

INTRUSION PREVENTION (ISOLATION) Single-Shell Tanks only

Partially Interim Isolated (PI)

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Interim Isolated (II)

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993, Interim Isolation was replaced by Intrusion Prevention.

Intrusion Prevention (IP)

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

Controlled, Clean, and Stable (CCS)

Controlled, Clean, and Stable reflects the completion of several objectives: "Controlled" provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis; "Clean" - remove surface soil contamination and downpost the Tank Farms to RBA/URMA/RA radiological control status, remove abandoned equipment, and place reusuable equipment in compliant storage; and "Stable" - remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

TANK INTEGRITY

Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Assumed Re-Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicates a new loss of liquid attributed to a breach of integrity.

TANK INVESTIGATION

Intrusion

A term used to describe the infiltration of liquid into a waste tank.

SURVEILLANCE INSTRUMENTATION

Drywells are vertical boreholes with 6-inch (internal diameter) carbon steel casings positioned radially around SSTs. These wells range between 50 and 250 feet in depth, and are monitored between the range of 50 to 150 feet. The wells are sealed when not in use. They are called drywells because they do not penetrate to the water table and are therefore usually "dry." There are 759 drywells.

Monitoring is done by gamma radiation or neutron-moisture sensors to obtain scan profiles of radiation or moisture in the soil as a function of well depth, which could be indicative of tank leakage.

Two single-shell tanks (C-105 and C-106) are currently monitored monthly by gamma radiation sensors. The remaining drywells are monitored by gamma radiation sensors on request. Monitoring by neutron-moisture sensors is done only on request.

HNF-FP-0182-105

<u>Laterals</u>

Laterals are horizontal drywells positioned under single-shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base. There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Surface Levels

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Computer Automated Surveillance System (CASS).

Automatic FIC

An automatic waste surface level measurement device is manufactured by the Food Instrument Company (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and also transmit the reading to the CASS. Some tanks have gauges connected to CASS and others are read manually. FICs are being replaced by ENRAF detectors (see below).

ENRAF 854 ATG Level Detector

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. The displacer is connected to a wire wound onto a precision measuring drum. A level causes a change in the weight of the displacer which will be detected by the force transducer. Electronics within weight of the displacer which will be detected by the following the first serve motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches. The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the Tank Monitor and Control System (TMACS). The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Annulus

The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. Alarms from the annunciators are received by CASS. Continuous Air Monitoring (CAM) alarms are also located in the annulus. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

In-tank liquid observation wells are used for monitoring the interstitial liquid level (ILL) in single-shell waste storage tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL, a trademark of E. I. du Pont de Nemours & Company). There are a few LOWs constructed of steel. LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends and have a nominal outside diameter of 3.5 inches. Two probes are used to monitor changes in the ILL; gamma and neutron, which can indicate intrusions or leakage by increases or decreases in the ILL. There are 65 LOWs (64 are in operation) installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid, and in two DSTs only. The LOWs installed in two DSTs, (102-SY and 103-AW Tanks), are constructed of steel and are used for special, rather than routine, surveillance purposes only.

Thermocouple (TC)

A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple on a device (probe) is called a thermocouple tree. In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only, there are thermocouple elements installed in the insulating concrete, the lower primary tank knuckle, the secondary tank concrete foundation, and in the outer structural concrete.

These monitor temperature gradients within the concrete walls, bottom of the tank, and the domes. In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees installed. A single thermocouple (probe) may be installed in a riser, or lowered down an existing riser or LOW. There are also four thermocouple laterals beneath Tank 105-A in which temperature readings are taken in 34 thermocouples.

In-tank Photographs and Videos
In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

HNF-EP-0182-105

TERMS/ACRONYMS

CASS	Computer Automated Surveillance System
<u>ccs</u>	Controlled, Clean and Stable (tank farms)
<u>11</u>	Interim Isolated
<u>IP</u>	Intrusion Prevention Completed
<u>15</u>	Interim Stabilized
MT/FIC/ENRAF	Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)
<u>osd</u>	Operating Specifications Document
<u>osr</u>	Operational Safety Requirements
<u>PI</u>	Partial Interim Isolated
SAR	Safety Analysis Reports
SHMS	Standard Hydrogen Monitoring System
TMACS	Tank Monitor and Control System
<u>TPA</u>	Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology, U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment, 1994 (Tri-Party Agreement)
uso	Unreviewed Safety Question
Wyden Amendme	"Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5, 1990, Public Law 101-510.

4. INVENTORY AND STATUS BY TANK - VOLUME CALCULATIONS/DEFINITIONS FOR TABLE E-6 (SINGLE-SHELL TANKS)

COLUMN HEADING	VOLUME CALCULATIONS/DEFINITIONS
Total Waste	Solids volume plus Supernatant liquid. Solids include sludge and saltcake (see definitions below) Supernatant Liquid Drainable Liquid Remaining minus Drainable Interstitial. Supernate is the clear liquid floating on the surface of the waste. Supernate is usually derived by subtracting the solids level measurement from the liquid level measurement. In some cases, the supernatant volume includes floating solid crusts because their volume cannot be measured. In-tank photographs or videos are useful in estimating the liquid volumes; the area of solids covered and the average depth can be estimated.
Drainable Interstitial Liquid	Drainable Liquid Remaining minus Supernate. Drainable interstitial liquid is calculated based on the saltcake and sludge volumes, using average porosity values or actual data for each tank, when available. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. Drainable interstitial liquid is calculated based on the saltcake and sludge volumes in the tank. The sum of the interstitial liquid contained in saltcake and sludge is the initial volume of drainable interstitial liquid. The volume reported as Drainable Interstitial Liquid is the initial volume of drainable interstitial liquid minus interstitial liquid removed by pumping.


HNF-EP-0182-105

COLUMN HEADING	VOLUME CALCULATIONS/DEFINITIONS
Pumped This Month	Net total gallons of liquid pumped from the tank during the month. If supernate is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume. The total pumped volume is subtracted from drainable liquid remaining and pumpable liquid remaining. Pump production takes into account the amount of water added to the tank during the month (if any).
Total Pumped	Cumulative net total gallons of liquid pump from 1979 to date.
Drainable Liquid Remaining	Supernate plus Drainable Interstitial. (See Supernatant Liquid and Drainable Interstitial Liquid above for definitions). The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernate minus total gallons pumped.
Pumpable Liquid Remaining	Drainable Liquid Remaining minus undrainable heel volume. (Dish bottom tanks have a "heel" where liquids can collect: flat bottom tanks do not). (See Drainable Liquid Remaining and Pumped this Month for definitions). Not all drainable interstitial liquid is pumpable. It is assumed that drainable interstitial liquid on top of the undrainable heel in sludge or saltcake, is not jet pumpable. Therefore, pumpable interstitial liquid is the initial volume of drainable interstitial liquid minus the amount of interstitial liquid on top of the heel. The volume shown as Pumpable Liquid Remaining is the sum of pumpable interstitial liquid and supernate minus total gallons pumped.
Sludge	Solids formed during sodium hydroxide additions to waste. Sludge usually was in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume.
Saltcake	Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator. If saltcake is layered over sludge, it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume.
Solids Volume Update	Indicates the latest update of any change in the solids volume.
Solids Update Source - See Footnote	Indicates the source or basis of the latest solids volume update.
Last In-tank Photo	Date of last in-tank photographs taken.
Last In-tank Video	Date of last in-tank video taken.
See Footnotes for These Changes	Indicates any change made the previous month. A footnote explanation for the change follows the Inventory and Status by Tank section (Table E-6).

This page intentionally left blank

APPENDIX D

TANK FARM CONFIGURATION, STATUS, AND FACILITY CHARTS

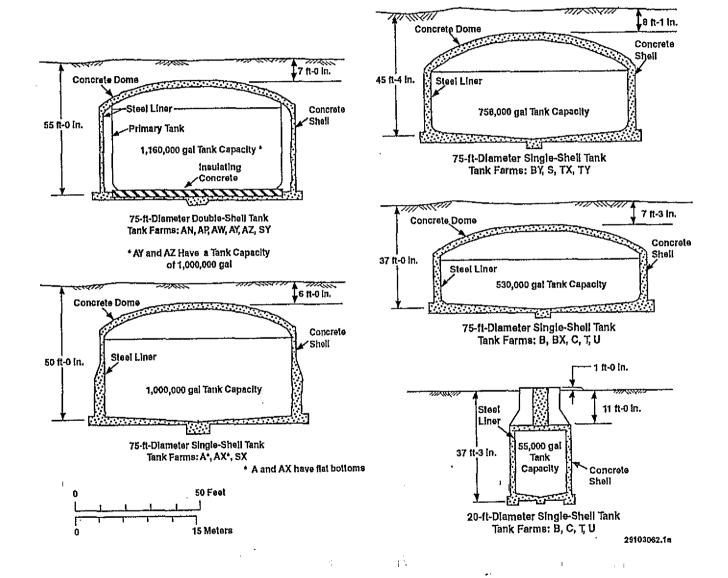

D-2

FIGURE D-1. HIGH-LEVEL WASTE TANK CONFIGURATION

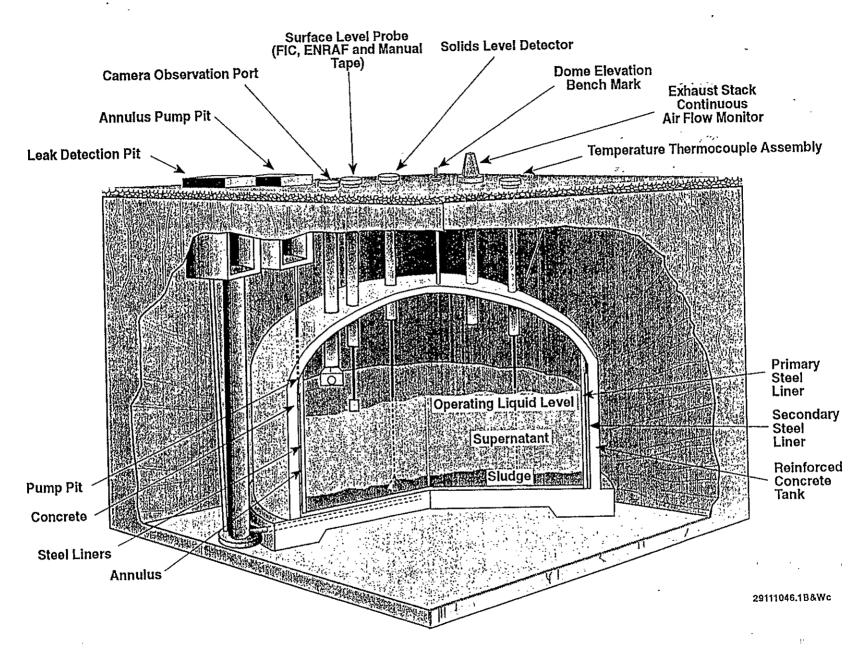


FIGURE D-2. DOUBLE-SHELL TANK INSTRUMENTATION CONFIGURATION



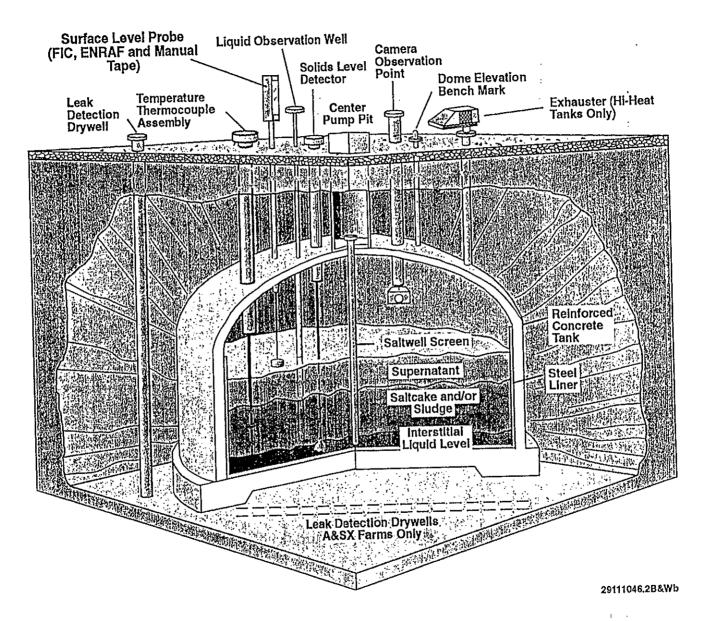


FIGURE D-3. SINGLE-SHELL TANK INSTRUMENTATION CONFIGURATION

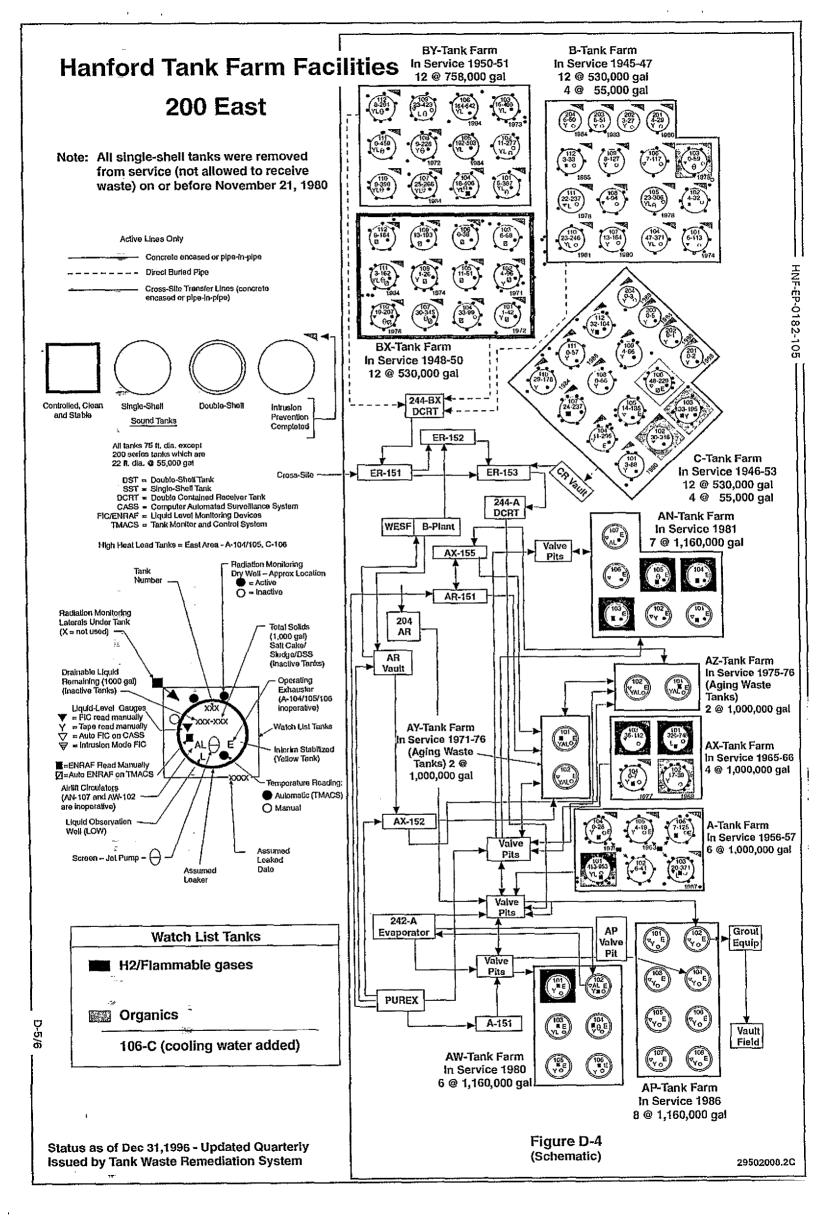

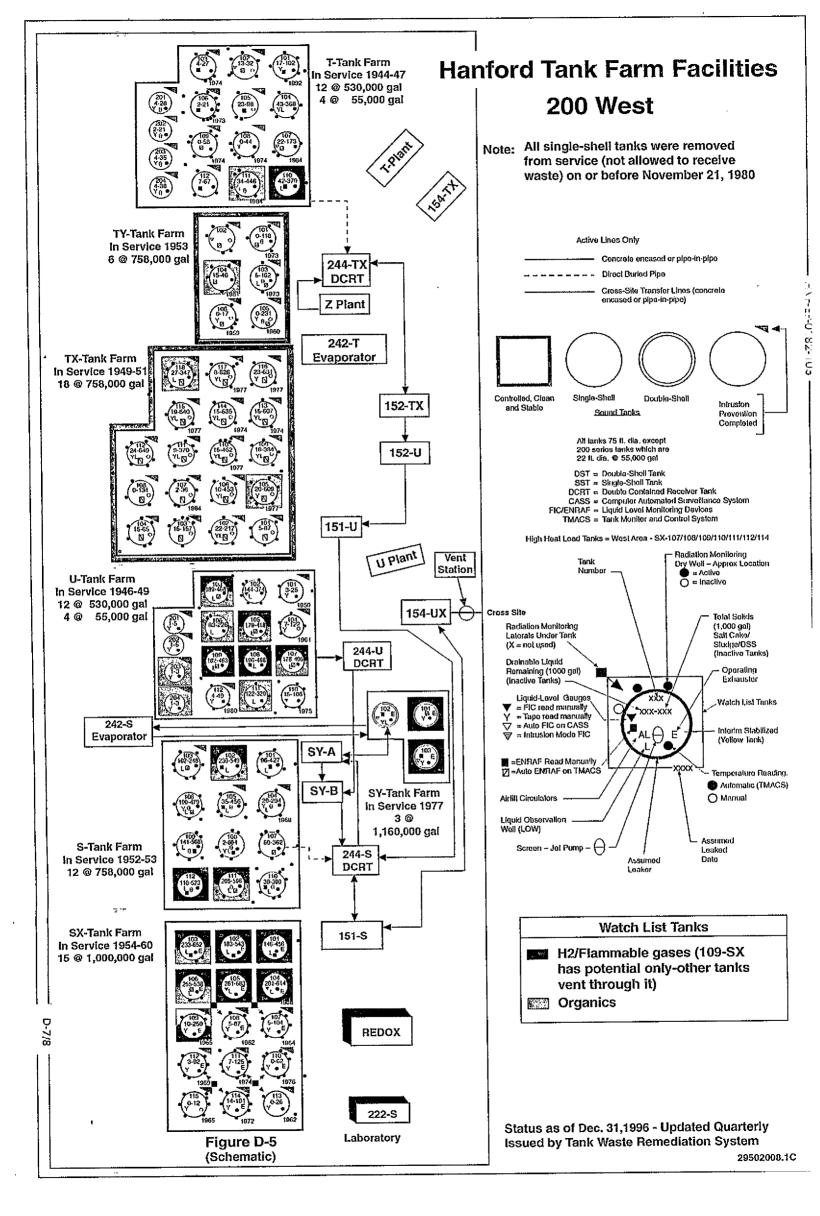

APPENDIX E

MONTHLY SUMMARY
TANK USE SUMMARY
PUMPING RECORD, LIQUID STATUS AND PUMPABLE
LIQUID REMAINING IN TANK FARMS
INVENTORY SUMMARY BY TANK FARM
INVENTORY AND STATUS BY TANK

TABLE E-1. MONTHLY SUMMARY

TANK STATUS

December 31, 1996

	200	200	
	EAST AREA	WEST AREA	<u>TOTAL</u>
IN SERVICE	25	03	28 (1)
OUT OF SERVICE	66	83	149
SOUND	59	51	110
ASSUMED LEAKER	32	35	67
INTERIM STABILIZED	58	58	116 (2)
ISOLATED			
PARTIAL INTERIM	11	30	41
INTRUSION PREVENTION COMPLETE	55	53	108
CONTROLLED, CLEAN, AND STABLE	12	24	36

		WASTE VO	UMES (Kgallo	ns)			
		200	200		SST	DST	
		EAST AREA	WEST AREA	<u>TOTAL</u>	TANKS	<u>TANKS</u>	TOTAL
SUPERNA	TANT	•	•				
AGING	Aging waste	1666	0	1666	0	1666	1666
cc	Complexant concentrate waste	2197	1450	3647	3	3644	3647
CP	Concentrated phosphate waste	1096	0	1096	0	1096	1096
DC	Dilute complexed waste	876	1	877	2	875	877
DN	Dilute non-complexed waste	3089	0	3089	0	3089	3089
DN/PD	Dilute non-complex/PUREX TRU solid	309	0	309	0	309	309
DN/PT	Dilute non-complex/PFP TRU solids	0	539	539	0	539	539
NCPLX	Non-complexed waste	207	279	486	486	0	486
DSSF	Double-shell slurry feed	4129	48	4177	57	4120	4177
TOTAL	SUPERNATANT	13569	2317	15886	548	15338	15886
SOLIDS							
Double-	-shell slurry	937	0	937	0	937	937
Sludge		8486	6251	14737	12037	2700	14737
Saltcak	re .	6280	16809	23089	22974	115	23089
TOTAL	SOLIDS	15703	23060	38763	35011	3752	38763
TOT	AL WASTE	29272	25377	54649	35559	19090	54649
AVAILAB	LE SPACE IN TANKS	11237	953	12190	0	12190	12190
DRAINAB	LE INTERSTITIAL	1980	4080	6060	5855	205	6060
DRAINAB	LE LIQUID REMAINING	15550	6397	21947	6404	15543	21947

(1) Includes six double-shell tanks on Hydrogen Watch List not currently allowed to receive waste, AN-103, AN-104, AN-105, AW-101, SY-101, and SY-103.

(2) Includes one tank (B-202) which does not meet current established supernatant and interstitial liquid stabilization criteria.

			····		ISOLATED TAI			
					INTRUSION	CONTROLLED	_ INTERIM	
ANK	TANKS RECEIVING		ASSUMED	PARTIAL	PREVENTION	CLEAN, AND	TABILIZED	
FARMS	WASTE TRANSERS	SOUND	LEAKER	<u>INTERIM</u>	<u>COMPLETED</u>	<u>STABLE</u>	<u>TANKS</u>	
	i							
AST	0	3	3	2	4	0	5	
4	7 (1)	7	ő	0	0		0	
AN		8	Ö	0	Ô		0	
AP	8	6	0	0	Ö		0	
ΑW	6 (1)	2	2	1	3		3	
AX	0		0	Ò	0		0	
AY	2	2	0	0	Ö		0	
AZ	2	2		0	16		16	(2)
В	0	6	10	0	12	12	12	,
BX	0	7	5	5 ·	7	12	8	
BY	0	7	5	3	13		14	
C	0	9	7	3	13			
Total	25	59	32	11	55	12	58	
WEST								
s	O	11	1	10	2		3	
SX	0 .	5	10	6	9		9	
SY	3 (1)	3	0	0	0		0	
T.	0	9	7	5	11		14	
TX	Ö	10	8	0	18	18	18	
TY	0	1	5	0	6	6	6	
บ	, O	12 +	4	9	· 7	;	. 8	
	.							863388°
Total	3	51	35	30	5 53	24	58	
TOTAL	284	110	67	41	108	36	116	

HNF-EP-0182-105

(1) Six Double-Shell Tanks on the Hydrogen Tank Watch List are not currently receiving waste transfers (AN-103, 104, 105, AW-101, SY-101 and 103).

(2) Includes tank B-202 which no longer meets established supernatant interstitial liquid stabilization criteria.

TABLE E-3. PUMPING RECORD, LIQUID STATUS AND PUMPABLE LIQUID REMAINING IN TANK FARMS

December 31, 1996

			Waste Vo	olumes (Kgallons)				
TANK FARMS	PUMPED THIS MONTH	PUMPED FY TO DATE	CUMULATIVE TOTAL PUMPED 1979 TO DATE	SUPERNATANT LIQUID	DRAINABLE INTERSTITIAL REMAINING	DRAINABLE LIQUID REMAINING	PUMPABLE LIQUID REMAINING	
AST	0.0	0.0	150.5	9	441	450	441	
4	N/A	N/A	N/A	4217	51	4268	N/A	
AN NB	N/A N/A	N/A	N/A	3499	11	3510	N/A	ļ
AP	N/A	N/A	N/A	2341	135	2476	N/A	1
AW AV	0.0	0.0	13.0	3	370	373	344	Ì
ΑX	N/A	N/A	N/A	1626	4	1630	N/A	ļ
AY AZ	N/A	N/A	N/A	1666	4	1670	N/A	
	0.0	0.0	0.00	15	164	179	80	
3	N/A	0.0	200.2	· 21	107	129	N/A	
BX	0.0	3.5	1567.7	0	519	519	401	i
BY C	0.0	0.0	103.0	172	174	346	272	
Total	0.0	3.5	2034.4	13569	1980	15550	1538	
WEST						4004	4400	
S	0.0	0.0	853.6	. 58	1173	1231	1138	
SX	0.0	0.0	113.2	63	1298	1361	1445	
SY	N/A	N/A	N/A	198 9	0	1989	N/A	
T	0.0	5.2	134.9	31	190	221	178	
TX	N/A	0.0	1205.7	5	250	255	. N/A	
TY	N/A	0.0	29.9	3	31	34	N/A	
Ü	0.0	0.0	0.0	168	1138	1306	1377	200
Total	0.0	5.2	2337,3	2317	4080	6397	4138	
TOTAL	0.0	8.7	4371.7	15886	6060 (1)	21947	5676 (1)	

(1) Volume based on 21% (sludge waste) and 50% (saltcake waste) liquid in solid (porosity) value, per WHC-SD-W236A-ES-012, Rev. 1, dated May 21, 1996, a re-evaluation of the non-stabilized tanks.

N/A = Not applicable for Double-Shell Tank Farms, and Single-Shell Tank Farms which have been declared Controlled, Clean, and Stable (BX, TX, TY)

1

TABLE E-4. INVENTORY SUMMARY BY TANK FARM

December 31, 1996

					SUPERN	IATAN	T LIQUI	D VO	LUMES	Kgall	ons)			SOLID.	S VOLUN	1E
TANK	TOTAL	AVAIL		<u></u>											SALT	
FARM	WASTE	SPACE	AGING	CC	CP	DC	DN I	DN/PD	DN/PT	DSSE	NCPLX	TOTAL	DSS S	LUDGE	_CAKE	TOTAL
EAST.																
	1537	0	o	0	0	0	0	0	0	9	0	9	0	556	972	1528
A	5804	2176	0	2194	0	0	84	0	0	1939	0	4217	937	650	0	1587
AN -	3654	5466	0	0	1096	56	1305	0	0	1042	0	3499	0	155	0	155
AP	3619	3221		0	0	0	893	309	0	1139	0	2341	0	1167	111	1278
AW	906	0	0	3	0	0	0	0	0	0	0	3	0	19	884	903
AX		210		0	0	819	807	0	0	0	0	1626	0	124	o	124
AY	1750	164	1666	0	0	0,5	0	0	0	0	0	1666	0	130	o	130
AZ -	1796	0	0	0	0	0	0	0	0	0	15	15	0	1697	345	2042
В	2057			0	0	0	0	0	0	0	21	21	0	1351	121	1472
BX	1493 4680	0	,	0	0	0	0	0	0	0	0	0	0	833	3847	4680
BY	4680 1976	0	0	0	0	1	0	0	0	0	171	172	0	1804	0	1804
C	1976	U	ľ	U	v	•	v	·	·							
2000000	*******	11237	1666	2197	1096	876	3089	309	0	4129	207	13569	937	8486	6280	15703
Total	29272	:::::IIZ 3 /	1000	<i>;;;;43,9</i> 94;;;		;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;	**************************************					1948407-7-0044	30000000000000000000000000000000000000	· 1999	zeizezeile zeilerle seles des	2220-2220-2239
****			İ									ļ	1			[
WEST				^	0	0	0	. 0	0	17	41	58	0	1166	4132	5298
S	5356		0	0	0	1	0	0	0	0		63	0	1254	3102	4356
sx	4419		0	_	-		0	0	539	0		1989	0	474	4	478
SY	2467		0	1450	0	0	_	_	555	0		31	o	1907	0	1907
Т	1938		0	0	0	0	0	0		0		5	Ö	241	6763	7004
TX	7009			0	0	0	0	0	0			3	0	571	64	635
TY	638		1	. 0	0	0	0	0	0	0	_		0	638	2744	3382
U	3550	0	0	0	0	0	0	0	0	31	137	168	"	636	Z/4 4	3302
		************	200000000000000000000000000000000000000			903000 YES	5580 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 558 S 5	0				2317	0	6251	16809	23060
Total	25377	953	0	1450	0		0	0	539	48	279	2316			18000	23060
			8 -98830000000000000	00000000000000000000000000000000000000		9800000X VA			WW.			1	937	* 14737	23089	38763
TOTAL	54649	12190	1666	* 3847	¥1096±	877	3089	× 309	539	4777	486	15886	10000100	14121	#3U03	1000100

HNF-EP-0182-105

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE SHELL TANKS

December 31, 1996

			TANK S	TATUS					LIQU	ID VOLUM	IE	so	DLIDS VOL	UME	VOLU	ME DETERM	INATION	PHOTOS/	/IDEOS	<u> </u>
					EQUIVA-			SUPER-	DRAIN- ABLE	DRAIN- ABLE	PUMP- ABLE									SEE FOOTNO
					LENT	TOTAL A	AVAIL.	NATANT	INTER-	LIQUID	LIQUID				רוסחום	SOLIDS	SOLIDS	LAST	LAST	FOR
		WAST	TANK	TANK	WASTE	WASTE	SPACE	LIQUID	STIT.	REMAIN	REMAIN	DSS	SLUDGE	SALT	VOLUM	E VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TAI	NK	MATL	INTEGRITY	USE	INCHES	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)		CAKE	метно	D METHOD	UPDATE	РНОТО	VIDEO	CHANG
										AN TAN	K FARM S	PITTAT								
ΔN	-101	DN	SOUND	DRCVR	42.5	117	1023	84	0	84	84	0	33	o	FM	s	04/30/96	0/ 0/ 0		1
	-102		SOUND	CWHT	391.3	1076	64	987	3	990	987	ő	89	o	FM	s	08/22/89	0/0/0		
	-103		SOUND	CWHT	347.6	956	184	19	0	19	19	937	0	0	FM	S	08/22/89	10/29/87		l
	-104		SOUND	CWHT	384.0	1056	84	792	25	817	795	0	264	0	FM	s	08/22/89	08/19/88		
	-105	-	SOUND	CWHT	410.2	1128	12	1128	0	1128	1128	o	0	0	FM	s	10/22/84	01/26/88		1
	-106		SOUND	CWHT	151.3	416	724	399	0	399	399	ő	17	0	FM	s	08/22/89	0/0/0		
	-107		SOUND	CWHT	383.6	1055	85	808	23	831	809	lŏ	247	0	FM	s	08/22/89	09/01/88		
7313	-107		300110	O,MI	303.0	1000	05		2.0	- 001					<u> </u>		00/22/00	00,01,00		
7 C	OUBL	E-SHELL	TANKS		TOTALS	5804	2176	4217	51	4268	4221	937	650	0						
												,								
										AP TAN	K FARM S	TATUS								
AP	-101	DSSF	SOUND	DRCVR	378.9	1042	98	1042	0	1042	1042	0	0	0	FM	S	05/01/89	0/ 0/ 0		ļ
AP	-102	CP	SOUND	GRTFD	398.5	1096	44	1096	0	1096	1096	0	0	0	FM	S	07/11/89	0/ 0/ 0		
ΑP	-103	DN	SOUND	DRCVR	8.0	22	1118	21	0	21	21	0	1	0	FM	S	05/31/96	0/0/0		İ
AP	-104	DN	SOUND	GRTFD	9.5	26	1114	26	0	26	26	0	0	0	FM	S	10/13/88	0/ 0/ 0		1
ΑP	-105	DN	SOUND	CWHT	408.0	1122	18	968	11	979	968	0		0	FM	S	04/30/96	0/ 0/ 0	09/27/98	5
AP	-106	DN	SOUND	DRCVR	98, 2	270	870	270	0	270	270	0	0	0	FM	S	10/13/88	0/0/0		1
ΑP	-107	DN	SOUND	DRCVR	7.3	20	1120	20	0	20	20	0	0	0	FM	S	10/13/88	0/0/0		
ΑP	-108	DC	SOUND	DRCVR	20.4	56	1084	56	0	56	56	0	0	0	FM	S	10/13/88	0/ 0/ 0		
8 [ooubi	E-SHEL	L TANKS		TOTALS	3654	5466	3499	11	3510	3499	0	155	0						
											W T 1 D 2	om i meric								
		Beer	0011112	04***	440.0	4400		1 4044		•	K FARM			_	1		10/20/04	03/17/88		1
		DSSF	SOUND	CWHT	410.2	1128	12	1044	2	1046	1044	0	=	0		S	10/22/84			1
	V-102		SOUND	EVFD	36.0	99	1041	63	0	63	63	0		0	ŀ	S	04/30/96			
			SOUND	DRCVR		513	627	150	37	187	165	0		0	1	S	02/01/89			1
	V-104		SOUND	DRCVR		1120	20	830	49	879	857	0		111	FM	s s	03/05/87			
		•	SOUND	DRCVR		439	701	159	27	186	164	0		0	i		05/31/96	0/0/0		1
AV	N-106	DSSF	SOUND	SRCVR	116,4	320	820	95	20	115	95	0	225	0	FM	S	04/30/96	02/02/83		
		. C. O. I.E.	L TANKS		TOTALS	3619	3221	2341	135	2476	2388	0	1167	111	 			 		

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE SHELL TANKS

December 31, 1996

		TANK S	TATUS					LIQU	ID VOLUN	1E		SOLIDS V	DLUME	VOL	UME DETER	MINATION	PHOTO	S/VIDEOS	·
				EQUIVA-			SUPER-	DRAIN- ABLE	DRAIN- ABLE	PUMP- ABLE									SEE FOOTNO
				LENT	TOTAL	AVAIL.	NATANT	INTER-	LIQUID	เมดบเอ				LIQUID	SOLIDS	SOLIDS	LAST	LAST	FOR
	WAST	TANK	TANK	WASTE	WASTE	SPACE	LIQUID	STIT.	REMAIN	REMAIN	DSS	SLUDGE	SALT	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MATL	INTEGRITY	USE	INCHES	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)		CAKE	метног	METHOD	UPDATE	РНОТО	VIDEO	CHANG
-	•••								AN TANK	FARM ST	ZITTA								
XY-101	DC	SOUND	DRCVR	332.0	913	67	819	4	823	B19	0	94	0	[FM	s	05/31/96	12/28/82		1
AY-102		SOUND	DRCVR		837	143	807	o	807	807	0	30	0	FM	\$	05/31/96			
					•	-													<u> </u>
DOUB	LE-SHELL	. TANKS		TOTALS	1750	210	1626	4	1630	1626	0	124	0						
									AP TANK	FARM ST	ATUS						i		
AZ-101	AGING	SOUND	CWHT	321.1	883	97	848	0	848	848	0	35	0		S		08/18/83		
AZ-102	AGING	SOUND	DRCVR	332.0	913	67	818	4	822	818	0	95	0	FM	S	06/04/92	10/24/84		1
2 DOUB	LE-SHELL	TANKS		TOTALS	1796	164	1666	4	1670	1666	0	130	0					····	
						•													•
							,	i		C FARM ST	ATUS								
SY-101		SOUND	CWHT	405.8	1116	24	1075	0	1075	1075	0	41	0		S		04/12/89		
		SOUND	DRCVR	221.8	610	530	539	0	539	539	0	71	0	i	S	05/12/87			1
SY-103	CC	SOUND	CWHT	269.5	741	399	375	0	375	375	0	362	4	FM	S	10/22/84	10/01/85		
3 DOUB	LE-SHELI	TANKS		TOTALS	2467	953	1989	0	1989	1989	0	474	4						
GRAND	TOTAL				19090	12190	15338	205	15543	15389	937	2700	115						

Note: +/- 1 Kgal differences are the result of computer rounding

Available Space Calculations

Used in This Document

TOUR IN THIS BOOKING.

(Most Conservative)

AN, AP, AW, SY 1,140,000 gal (414.5 in.)
AY, AZ (Aging Waste) 980,000 gal (356.4 in.)

Tank Farms

IOSR WHC-SD-WM-OSR-16 (AN, AP, AW, SY)

WHC-T-151-00009 (Aging Waste)

1,144,000 gal (416 in.)(AN, AP, SY)

1,127,500 (410 in.)(AW-Farm)

1,000,000 gal (363.6 in.)(AY, AZ)

it organi

December 31, 1996

	TANK S	INTOO					riu	UID VOLU	VIE	<u> </u>	SOLIDS	VOLUME	VOLUM	E DETERMIN	VA HON	PHOTOS/\	TIDEUS	! _
		•				DRAIN-			DRAIN-	PUMP-								SEE
					SUPER-	ABLE	PUMPED		ABLE	ABLE	t		İ					FOOTNOTE
			STABIL/	TOTAL	NATE	INTER-	THIS	TOTAL	rignid	LIQUID	[SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	LIQUID	STIT.	HTOOM	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	AOFAWE	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	РНОТО	VIDEO	CHANGES
								А ТА	NK FARM	STATUS								
A-101	DSSF	SOUND	/PI	953	0	413	0.0	0,0	413	441] з	950	l P	F	11/21/80	08/21/85		[
A-102	DSSF	SOUND	IS/PI	41	4	2	0.0	39,5	6	0	15	22	Р	FP	07/27/89	07/20/89		
A-103	DSSF	ASMD LKR	IS/IP	371	5	15	0.0	111.0	20	0	366	0	[.	ΕĐ	06/03/88	12/28/88		[
A-104	NCPLX	ASMD LKR	IS/IP	28	0	0	0.0	0.0	0	0	28	0	м	PS	01/27/78	06/25/86		
A-105	NCPLX	ASMD LKR	IS/IP	19	0	4	0.0	0.0	4	0	19	0	P	MP	08/23/79	08/20/86		
A-106	CP	SOUND	IS/IP	125	0	7	0.0	0.0	7	0	125	0	P	M	09/07/82	08/19/86		1
6 SING	LE-SHELL T	ANKS	TOTALS	1537	9	441	0.0	150.5	450	441	556	972	<u> </u>					L
								***************************************	NK FARM		1 _			_				1
AX-101		SOUND	/Pl	748	0	320	0,0	0.0	320	338	3	745	P	F	05/06/82			-
AX-102		ASMD LKR	IS/IP	39	3	14	0.0	13.0	17	. 3	7	29	F -	S	09/06/88			
AX-103		SOUND	IS/IP	112	0	36	0.0	0.0	36	3	2	110	F	S	08/19/87	08/13/87		
AX-104	NCPLX	ASMD LKR	IS/IP	7	0	0	0.0	0,0	o	0	7	0	P	М	04/28/82	08/18/87		
4 SING	LE-SHELL 1	ANKS	TOTALS:	906	3	370	0.0	13.0	373	344	19	884						
								R TA	NK FARM	STATTIS								•
B-101	NCPLX	ASMD LKR	IS/IP	113	l 0	6	0.0	0.0	6	0	113	0	P	F	04/28/82	05/19/83		I
B-102	NCPLX	SOUND	IS/IP	32	4	0	0.0	0.0	4	0	1	10	'P	F	08/22/85			ļ
B-103	NCPLX	ASMD LKR	IS/IP	59	0	0	0.0	0.0	0	0	59	0	, F	F	02/28/85	10/13/88		}
B-104	NCPLX	SOUND	IS/IP	371	1	46	0.0	0.0	47	40	301	69	м	M	06/30/65	l .		1
B-105	NCPLX	ASMD LKR	IS/IP	306	;	23	0.0	0.0	23	0	1	266) ""	MP	12/27/84			1
B-106	NCPLX	SOUND	IS/IP	117	Ĭ	6	0.0	0.0	7	0	116	0	F	F	03/31/85			
B-107	NCPLX	ASMD LKR	IS/IP	165		12	0.0	0.0	13	7	164	0	м	M.	03/31/85			
		SOUND	-	94	,	4	0.0	0.0	4	,		0		F	05/31/85			
B-108	NCPLX	SOUND	IS/IP		0	8	-	0.0	8	0	i	0		M	04/08/85	-		1
B-109	NCPLX		IS/IP	127	1	22	0.0	0.0	23	1 [†] 7	245	0		MP	02/28/85			1
B-110	NCPLX	ASMD LKR	IS/IP	246	1 .							0		F				
B-111	NCPLX	ASMD LKR	IS/IP	237	1	21	0.0	0.0	22	16	j .		•	r F	06/28/85			1
B-112	NCPLX	ASMD LKR	IS/IP	33	3	0	0.0	0.0	3	0	30	0			05/31/85		Actorios	.[
B-201	NCPLX	ASMD LKR	IS/IP	29	1	3	0.0	0.0	4	0	28	0		M	04/28/82			1
B-202	NCPLX	SOUND	IS/IP	27	0	3	0,0	0.0	3	0	1	0		M	05/31/85	· ·	06/16/98	<u>'</u>
8-203	NCPLX	ASMD LKR	IS/IP	51	1,	5	0.0	0.0	6	0	1 '	0	1	PM	05/31/84	,		
B-204	NCPLX	ASMD LKR	IS/IP	50	1	5	0,0	0.0	6	0	49	0	Р	M	05/31/84	10/22/87		

日 日 日

December 31, 1996

	TANK S	STATUS					LIO	UID VOLUI	ME		SOLIDS	VOLUME	VOLUM	E DETERMIN	VATION	PHOTOS	VIDEOS	
						DRAIN-			DRAIN-	PUMP-		_			. –			SEE
						ABLE	PUMPED		ABLE	ABLE		•	[FOOTNOT
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	FIGUID	riguid	1	SALT	riguids	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE		VOLUME	VOLUME	AOTAWE	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
			1-11-10-00			_			NK FARM		1	•	1 .		0.4.10.0.10.0	1 44 494 499	4440104	1
	NCPLX	ASMD LKR	IS/IP/CCS	43	1	0	0.0	0,0	1	0	42	0	P	M		11/24/88	11/10/94	
	NCPLX	ASMD LKR	IS/IP/CCS	96	0	4	0.0	0.0	4	0	96	0] P	M		09/18/85		Ì
	NCPLX	SOUND	IS/IP/CCS	68	6	0	0.0	0,0	6	0	62	0	P .	F 		10/31/86	10/27/94	•
	NCPLX	SOUND	IS/IP/CCS	99	3	30	0.0	17.4	33	27	96	0	F	F		09/21/89		1
	NCPLX	SOUND	IS/IP/CCS	51	5	6	0.0	15.0	11	4	43	3	F	S		10/23/86		
	NCPLX	SOUND	IS/IP/CCS	38	0	0	0.0	14.0	0	0	38	0	MP	PS		05/19/88	07/17/98	'l
	NCPLX	SOUND	Is/IP/CCS	345	1	29	0,0	23.1	30	23	344	0	MP	P		09/11/90		1
	NCPLX	ASMD LKR	IS/IP/CCS	26	0	1	0.0	0.0	1	0	26	О	M	PS		05/05/94		
	NCPLX	SOUND	IS/IP/CCS	193	0	13	0.0	8.2	13	В	193	0	FP	Р	09/17/90	09/11/90		
BX-110	NCPLX	ASMD LKR	IS/IP/CCS	207	3	16	0.0	1.5	19	13	195	9	MP	M	10/31/94	07/15/94	10/13/94	1
	NCPLX	ASMD LKR	IS/IP/CCS	162	1	1	0.0	116.9	3	. 1	52	109	M	M	04/06/95	05/19/94	02/28/95	i
BX-112	NCPLX	SOUND	IS/IP/CCS	165	1	7	0.0	4.1	8	2	164	0	FP	P	09/17/90	09/11/90		
					ļ						<u> </u>		<u> </u>			ļ	~	
12 SIN	BLE-SHELL	TANKS	TOTALS:	1493	21	107	0.0	200.2	129	78	1351	121	<u>[</u>			<u> </u>		<u> </u>
					ì				NK FARM							l		r
BY-101	NCPLX	SOUND	IS/IP	387	0	5	0.0	35,8	5	0	109	278	P	М		09/19/89		ļ
	NCPLX	SOUND	IS/PI	277	0	11	0.0	159.0	11	0	0	277	MP	М		09/11/87	04/11/95	
BY-103	NCPLX	ASMD LKR	/PI	400	0	15	0.0	98.9	15	9	5	395	MP	M	·=	09/07/89		i
BY-104	NCPLX	SOUND	IS/IP	406	0	18	0.0	329.5	18	0	40	366	P	M	04/28/82	04/27/83		
BY-105	NCPLX	ASMD LKR	/Pl	503	0	192	0.0	0.0	192	216	158	345	P	MP	04/28/82	07/01/86		}
BY-106	NCPLX	ASMD LKR	/PI	642	0	200	0.0	63.7	200	163	95	547	P	MP	04/28/82	11/04/82		
BY-107	NCPLX	ASMD LKR	IS/IP	266	0	25	0.0	56.4	25	0	60	206	P	MP	04/28/82	10/15/86		1
BY-108	NCPLX	ASMD LKR	IS/IP	228	0	9	0.0	27.5	9	0	154	74	MP	M	04/28/82	10/15/86		1
BY-109	NCPLX	SOUND	/PI	423	0	27	0.0	154.0	27	13	63	340	F	PS	08/30/91	10/15/86		(a)
BY-110	NCPLX	SOUND	IS/IP	398	0	9	0.0	213.3	9	0	103	295	M	S	09/10/79	07/26/84		1
BY-111	NCPLX	SOUND	IS/IP	459	0	0	oto	313.2	0	. 0	21	438	P	Mij	04/28/82	10/31/86		1
BY-112	NCPLX	SOUND	IS/IP	291	0	8	0.0	116.4	8	0	5	286	Р	M	04/28/82	04/14/88		
					1						1		1			1		1
12 SINI	3LE-SHELL	TANKS	TOTALS:	4680	0	519	0.0	1567.7	519	401	833	3847	 					1
1 T 2114		CIVIO	141050	-000	<u> </u>	9,0	V.0									1		

į

December 31, 1996

	TANK	STATUS								SOLIDS	VOLUME		VOLUM	DETERMIN	IATION	···**		
						DRAIN-			DRAIN-	PUMP-								SEE .
					1	ABLE	PUMPED		ABLE	ABLE	1		ł					FOOTNOTE
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	LIQUID		SALT	LIQUIDS	SOLIDS	souds	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgai)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
								<u>C_T/</u>	NK FARM	STATUS								
C-101	NCPLX	ASMD LKR	IS/IP	88	0	3	0.0	0.0	3	0	88	0	м	M	11/29/83	11/17/87		{
C-102	DC	SOUND	IS/IP	316	0	30	0.0	46.7	30	17	316	0	F	FP	09/30/95	05/18/76	08/24/95	1
C-103	NCPLX	SOUND	/Pt	195	133	0	0.0	0.0	133	133	62	0	F	S	10/20/90	07/28/87		•
C-104	CC	SOUND	IS/IP	295	0	11	0.0	0.0	11	5	295	0	FP	P	09/22/89	07/25/90		ļ
C-105	NCPLX	SOUND	IS/PI	134	2	30	0.0	0.0	32	9	132	0	F	S	10/31/95	08/05/94	08/30/95	ſ
C-106	NCPLX	SOUND	/PI	229	32	16	0,0	0.0	48	52	197	0	F	PS	04/28/82	08/05/94	08/08/94	ļ
C-107	DC	SOUND	IS/IP	237	0	24	0.0	40.8	24	15	237	0	F	S	09/30/95	00/00/00		
C-108	NCPLX	SOUND	IS/IP	66	0	0	0.0	0,0	0	0	66	0	M	S	02/24/84	12/05/74	11/17/94	[
C-109	NCPLX	SOUND	IS/IP	66	4	0	0.0	0.0	4	0	62	0	M	PS	11/29/83	01/30/76		Ī
C-110	DC	ASMD LKR	IS/IP	178	1	28	0.0	15,5	29	15	177	0	F	FMP	06/14/95	08/12/86	05/23/95	
C-111	NCPLX	ASMD LKR	15/ I P	57	0	0	0.0	0.0	0	0	57	0	M	S	04/28/82	02/25/70	02/02/95	
C-112	NCPLX	SOUND	IS/IP	104	0	32	0.0	0,0	32	· 26	104	0	M	PS	09/18/90	09/18/90		1
C-201	NCPLX	ASMD LKR	IS/IP	2	0	0	0.0	0.0	0	0	2	0	P	MP	03/31/82	12/02/86		
C-202	EMPTY	ASMD LKR	IS/IP	1	0	0	0.0	0.0	0	0	1	0	P	М	01/19/79	12/09/86		ſ
C-203	NCPLX	ASMD LKR	IS/IP	5	0	0	0.0	0.0	0	0	5	0	P	MP	04/28/82	12/09/86		ļ
C-204	NCPLX	ASMD LKR	IS/IP	3	0	0	0.0	0,0	0	0	3	0	P	MP	04/28/82	12/09/86]
6 SII	IGLE-SHELI	TANKS	TOTALS:	1976	172	174	0.0	103,0	346	272	1804	0						
								S T	ANK FARM	STATUS								
S-101	NCPLX	SOUND	/PI	427	12	84	0.0	0,0	96	127	244	171	F	PS	09/16/80	03/18/88		1
S-102	DSSF	SOUND	/PI	549	0	230	0.0	0.0	230	239	4	545	P	FP	04/28/82	03/18/88		}
S-103	DSSF	SOUND	/PI	248	17	85	0.0	0,0	102	97	10	221	М	S	11/20/80	06/01/89]
S-104	NCPLX	ASMD LKR	IS/IP	294	1	28	0.0	0,0	29	23	293	0	M	M	12/20/84	12/12/84		
S-105	NCPLX	SOUND	IS/IP	456	0	35	0.0	114.3	35	13	2	454	MP	S	09/26/88	04/12/89		
S-106	NCPLX	SOUND	/PI	479	4	186	0.0	97.0	180	168	28	447	P	FP	12/31/93	03/17/89	09/12/94	il.
S-1⊧07	NCPLX	SOUND	/Pi	376	14	45	0.0	0.0	59	88	293	69	F	PS	09/25/80	03/12/87		1
S-108		SOUND	IS /PI	450	0	4	0.0	199,8	4	0	4	446	P	MP	12/20/96	03/12/87	12/03/96	(b)
S-109	NCPLX	SOUND	/PI	568	0	141	0.0	111,0	141	119	13	555	F	PS	09/30/75	08/24/84		[
S-110	NCPLX	SOUND	/PI	390	0	30	0.0	203,1	30	23	131	259	F	PS	05/14/92	03/12/87		(c)
S-111	NCPLX	SOUND	/PI	596	10	195	0.0	3.3	205	134	139	447	P	FP	04/28/82	08/10/89		
S-112	NCPLX	SOUND	/PI	623	0	110	0.0	125.1	110	107	5	518	P	FP	12/31/93	03/24/87	•	
40.00	HOLE OVER	TANKS	TOTALO	E054	58	1173	0.0	853.6	1231	1138	1166	4132	 			 		
12 51	NGLE-SHELI	LIANKO	TOTALS:	5356	58	11/3	0,0	053,6	1231	1100	1 1100	4132				<u> </u>		1

四-10

December 31, 1996

	TANK S	TATUS					LIO	NID AOFRI	ME		SOLIDS	VOLUM		VOLUM	E DETERMIN	IATION		,
	 -	•				DRAIN- ABLE	PUMPED	-	DRAIN- ABLE	PUMP- ABLE								SEE FOOTNOTE
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	CIODIJ		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VÖLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	РНОТО	VIDEO	CHANGES
								SX TA	NK FARM	STATUS								
5X-101	DC	SOUND	/PI	456	1	145	0.0	0.0	146	174	112	343	l P	FP	04/28/82	03/10/89		1
	DSSF	SOUND	/PI	543	0	183	0,0	0.0	183	216	117	426	P	M	04/28/82	01/07/88		ļ
	NCPLX	SOUND	/PI	652	1	232	0.0	0.0	233	272	115	536	F	s	07/15/91	12/17/87		ł
SX-104	DSSF	ASMD LKR	/PI	614	0	201	0.0	113.2	201	195	136	478	F	s	07/07/89	09/08/88		
SX-10	DSSF	SOUND	/PI	683	0	261	0.0	0.0	261	299	73	610	P	F	04/28/82	06/15/88		1
SX-10	NCPLX	SOUND	/PI	538	61	194	0.0	0.0	255	264	12	465	į F	PS	10/28/80	06/01/89		
SX-10	NCPLX	ASMD LKR	IS/IP	104	0	5	0.0	0.0	5	0	104	0	P	M	04/28/82	03/06/87		1
SX-10	NCPLX	ASMD LKR	IS/IP	87	0	5	0.0	0.0	5	0	87	0	P	M	12/31/93	03/06/87		Ì
SX-109	NCPLX	ASMD LKR	IS/IP	244	0	48	0.0	0.0	48	25	0	244	P	M	01/10/96	05/21/86		
SX-110	NCPLX	ASMD LKR	IS/IP	62	0	0	0.0	0.0	0	0	62	0	М	PS	10/06/76	02/20/87		\
SX-111	NCPLX	ASMD LKR	IS/IP	125	0	7	0.0	0.0	7	0	125	0	M	PS	05/31/74	06/09/94		ĺ
SX-11:	NCPLX	ASMD LKR	IS/IP	92	0	3	0.0	0.0	3	. 0	92	0	P	M	04/28/82	03/10/87		
SX-11	NCPLX	ASMD LKR	IS/IP	26	0	0	0.0	0.0	0	0	26	0	P	M	04/28/82	03/18/88		1
\$X-11	NCPLX	ASMD LKR	IS/IP	181) 0	14	0.0	0,0	14	0	181	0	P	М	04/28/82	02/26/87		ļ
SX-11!	NCPLX	ASMD LKR	IS/IP	12	0	0	0.0	0.0	0	o	12	0	P	М	04/28/82	03/31/88		
15 SIN	GLE-SHELL	TANKS	TOTALS:	4419	63	1298	0.0	113	1361	1445	1254	3102						

					1 .				NK FARM		1 101	^	i -	^	04/14/93	04/07/93		1
T-101	NCPLX	ASMD LKR	IS/PI	102	1 1	16	0.0	25.3	17	0	101	0		S FP	08/31/84			
T-102	NCPLX	SOUND	IS/IP	32	13	0	0,0	0.0	13	13	19	0			11/29/83	1 ' '		1
T-103	NCPLX	ASMD LKR	IS/IP	27	4	0	0,0	0.0	4	0	23	0	1	FP				[,,,
T-104	NCPLX	SOUND	/P1	368	0	43	0.0	89.0	43	40	368	0	1	MP F		06/29/89 05/14/87		(d)
T-105	NCPLX	SOUND	IS/IP	98	0	23	0.0	0.0	23	17	98		1	-	05/29/87	1		
T-106	NCPLX	ASMD LKR	IS/IP	21	2	0		0.0	2	0	1	0	1	FP	04/28/82	•		
T-107	NCPLX	ASMD LKR	IS/PI	173	0	22	0.0	11.0	22	12	i .	0	1	FP	05/31/96	1	05/09/96	'n
T-108	NCPLX	ASMD LKR	IS/IP	44	0	0	0.0	0,0	0	0	44	0	P	M	04/28/82	07/17/84		1

111

1

. 12

December 31, 1996

	TANK S	TATUS					ria	UID VOLU	ME		SOLIDS	VOLUME	VOLUM	NE DETERMI	NATION			,
						DRAIN-			DRAIN-	PUMP-								SEE
						ABLE	PUMPED		ABLE	ABLE	1		1					FOOTNOT
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	FIGUID	FIGUID	1	SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
						_					1 55		٠.,		40,00,004	00105100		ı
-109	NCPLX	ASMD LKR	IS/IP	58	0	0	0,0	0.0	0	0	58	0	J M	M	12/30/84			-
r-110	NCPLX	SOUND	/PI	379	3	39	0,0	0.0	42	60	376	0		FP	04/28/82	07/12/84		.]
r-111	NCPLX	ASMD LKR	IS/PI	446	0	34	0.0	9.6	34	29	446	0	P	FP	04/18/94	· ·	02/13/95	<u>'</u>
T-112	NCPLX	SOUND	IS/IP	67	7	0	0.0	0.0	7	7	60	0	P	FP	04/28/82]
T-201	NCPLX	SOUND	IS/IP	29	1	3	0.0	0.0	4	0	28	0	[M	PS	05/31/78			
T-202	NCPLX	SOUND	IS/IP	21	0	2	0.0	0.0	2	0	21	0	FP	P	07/12/81	07/06/89		1
T-203	NCPLX	SOUND	IS/IP	35	0	4	0.0	0.0	4	0	35	0	M	PS	01/31/78	· ·		1
T-204	NCPLX	SOUND	IS/IP	38	0	4	0.0	0.0	4	0	38	0	FP	P	07/22/81	08/03/89		Ì
6 SIN	GLE-SHELL	TANKS	TOTALS:	1938	31	190	0.0	134.9	221	178	1907	0	<u> </u>					
									NK FARM		1				. 1			1
	NCPLX	SOUND	IS/IP/CCS	87	3	2		0.0	5	. 0	84	0	Į F	P	02/02/84	t i		
	NCPLX	SOUND	IS/IP/CCS	217	0	22		94.4	22	0	0	217	M	S	08/31/84	10/31/85		
TX-103	NCPLX	SOUND	IS/IP/CCS	157	0	15	0.0	68.3	15	0	157	0	F	S	08/14/80			1
	NCPLX	SOUND	IS/IP/CCS	65	1	14	0.0	3.6	. 15	0	0	64	F	FP	04/06/84			
	NCPLX	ASMD LKR	IS/IP/CCS	609	0	20	0.0	121.5	20	0	0	609	M	PS	OB/22/77	l		1
	NCPLX	SOUND	IS/IP/CCS	453	0	10	0.0	134.6	10	0	0	453	M	S	08/29/77]
TX-107	NCPLX	ASMD LKR	IS/IP/CCS	36	1	1	0.0	0.0	2,	0	0	35	FP	FP	01/20/84			1
TX-108	NCPLX	SOUND	IS/IP/CCS	134	0	0	0.0	13.7	0	0	0	134	P	FP	05/30/83	09/12/89		
TX-109	NCPLX	SOUND	IS/IP/CCS	384	0	10	0.0	72.3	10	0	0	384	F	PS	05/30/83	10/24/89		
TX-110	NCPLX	ASMD LKR	IS/IP/CCS	-462	0	15	0.0	115.1	15	0	0	462	M	PS	05/30/83	10/24/89		ľ
TX-111	NCPLX	SOUND	IS/IP/CCS	370	0	9	0,0	98.4	9	0	0	370	М	PS	07/26/77	09/12/69		
TX-112	NCPLX	SOUND	IS/IP/CCS	649	0	24	0.0	94.0	24	0	0	649	P	PS	05/30/83	11/19/87		
TX-113	NCPLX	ASMD LKR	IS/IP/CCS	607	0	16	0.0	19.2	16	0	0	607	М	PS	05/30/83	04/11/83	09/23/94	‡j
TX-114	NCPLX	ASMD LKR	IS/IP/CCS	535	0	15	0.0	104.3	15	0	0	535	M	PS	05/30/83	04/11/83	02/17/99	5
TX-11	NCPLX	ASMD LKR	IS/IP/CCS	640	0	19	0.0	99.1	19	0	0	640	м	S	03/25/83	06/15/88		
TX-110	NCPLX	ASMD LKR	IS/IP/CCS	631	0	23	0,0	.23.8	, 23	0	0	631	М	PS	03/31/72	10/17/89		1
	NCPLX	ASMD LKR	IS/IP/CCS	626	. 0	8		54.3	8	0	1100	626	M	PS	12/31/71	04/11/83	ľ	ĺ
	B NCPLX	SOUND	IS/IP/CCS	347	0	27	0.0	89.1	27	0	0	347	F	S	11/17/80	12/19/79		
					1								ļ		 ,			

E-12

December 31, 1996

	TANK S	TATUS					LIQ	UID VOLU	ME		SOLIDS	VOLUM	VOLUM	E DETERMIN	MOITAL	PHOTOS/	VIDEOS	<u> </u>
	·					DRAIN-			DRAIN-	PUMP-			İ					SEE
					SUPER-	ABLE	PUMPED		ABLE	ABLE	1				Ì			FOOTNOTE
			STABIL/	TOTAL	NATÈ	INTER-	THIS	TOTAL	LIQUID	LIQUID	·	SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	LIQUID	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	РНОТО	VIDEO	CHANGES
								TV TA	NK FARM	STATUS								
TV-101	NCPLX	ASMD LKR	IS/IP/CCS	118	ا ه	0	0.0	8,2	0	0	118	o	l P	F	04/28/82	08/22/89		1
	NCPLX	SOUND	IS/IP/CCS	64	ő	14	0.0	6.6	14	0	0	64	P	FP	06/28/82	07/07/87		
	NCPLX	ASMD LKR	IS/IP/CCS	162	٥	5		11.5	5	0	162	0	P	FP	07/09/82			
	NCPLX	ASMD LKR	IS/IP/CCS	46	3	12		0.0	15	0	43	0	P	FP	06/27/90			
	NCPLX	ASMD LKR	IS/IP/CCS	231	0	0		3,6	0	0	231	o	, ,	M	04/28/82			Į
	NCPLX	ASMD LKR	IS/IP/CCS	17	٥	0		0.0	0	0		0	P	M	04/28/82	08/22/89		
11-100	NOPEX	MOINID TKU	15/11/003	• • • • • • • • • • • • • • • • • • • •	١	Ü	0.0	0.0	·	Ů	"	v	'	141	04120102	00722703		
6 SING	LE-SHELL T	ANKS	TOTALS:	638	3	31	0.0	29.9	34	0	571	64						
								U TA	NK FARM	STATUS								_
U-101	NCPLX	ASMD LKR	IS/IP	25	3	0	0.0	0.0	3	0	22	0	Р	MP	04/28/82	06/19/79		}
U-102	NCPLX	SOUND	/PI	374	18	126	0.0	0.0	144	160	43	313	J P	MP	04/28/82	06/08/89]
U-103	NCPLX	SOUND	/PI	468	13	176	0.0	0.0	189	205	32	423	Р	FP	04/28/82	09/13/88		1
U-104	NCPLX	ASMD LKR	IS/IP	122	0	7	0.0	0.0	7	0	122	0	P	MP	04/28/82	08/10/89		
U-105	NCPLX	SOUND	/PI	418	37	142	0.0	0.0	179	192	32	349	FM	PS	09/30/78	07/07/88		İ
U-106	NCPLX	SOUND	/PI	226	15	68	0,0	0.0	83	85	26	185	F	PS	12/30/93	07/07/88		}
U-107	DSSF	SOUND	/PI	406	31	147	0.0	0.0	178	183	15	360	F	S	12/30/93	10/27/88		
U-108	NCPLX	SOUND	/P1	468	24	172	0,0	0.0	196	209	29	415	F	s	12/30/93	09/12/84		
U-109	NCPLX	SOUND	/PI	463	19	163	0.0	0.0	182	205	48	396	F	F	06/30/96	07/07/88		
U-110	NCPLX	ASMD LKR	IS/PI	186	0	15	0.0	0.0	15	9	186	0	М	M	12/30/84	12/11/84		1
U-111	DSSF	SOUND	/PI	329	0	122	0.0	0.0	122	129	26	303	PS	FPS	02/10/84	06/23/88		
U-112	NCPLX	ASMD LKR	IS/IP	49	4	0	0,0	0.0	4	0	45	0	P	MP	02/10/84	08/03/69		
U-201	NCPLX	SOUND	IS/IP	5	1	0	0,0	0.0	1	0	4	0	М	S	08/15/79	08/08/89		
U-202	NCPLX	SOUND	IS/IP	5		0	0.0	0.0	1	0	4	0	М	s	08/15/79	08/08/89	•	1
U-203	NCPLX	SOUND	IS/IP	3	1	0		0.0	1	0	2	o	М	s	08/15/79	06/13/89		
U-204	NCPLX	SOUND	IS/IP	3	į	0		0.0	H 10 1	0	2	О	М	·\$	08/15/79	06/13/89		
16 SIN	GLE-SHELL	TANKS	TOTALS:	3550	168	1138	0.0	0,0	1306	1377	638	2744	 -					 -
					1					···	1		1					
GRAND	TOTAL			35559	548	5855	0.0	4371.7	6404	5754	12037	22974	T			i		1

E-13

HNF-EP-0182-105

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

December 31, 1996

FOOTNOTES:

Total Waste is calculated as the sum of Sludge and Saltcake plus Supernate.

The category "Interim Isolated" (II) was changed to "Intrusion Prevention" (IP) in June 1993. See section C. "Tank and Equipment Code and Status Definitions." Stabilization information from WHC-SD-RE-TI-178 SST STABILIZATION RECORD, latest revision, or SST Stabilization or Cognizant Engineer

(a) BY-109 - Following information from Cognizant Engineer:

Saltwell pumping was resumed on September 11, 1996, and temporarily suspended October 18 for flammable gas issues...

Total waste: 423 Kgal (No change) Supernate: 0 Kgal (No change) Drainable Interstitial Liquid: 27 Kgal

Pumped this Month: O Kgal Total Pumped: 154 Kgal

Drainable Liquid Remaining: 27 Kgal Pumpable Liquid Remaining: 12.5 Kgal

Sludge: 83 Kgal (No change) Saltcake: 340 Kgal (No change)

Note: Drainable Interstitial, Drainable Liquid Remaining, and Pumpable Liquid Remaining astimates were updated based on current diptube readings and latest porosity estimates.

Total waste, sludge, and saltcake estimates will be adjusted at completion of pumping, based on in-tank photographs and final waste surface levels.

(b) S-108 - Following information from Cognizant Engineer:

Total waste: 450 Kgal

Supernate: O Kgal (No change)

Drainable Interstitial Liquid: 4.0 Kgal

Pumped this Month: O Kgal

Total Pumped: 199.8 Kgai

Drainable Liquid Remaining: 4.0 Kgal

Pumpable Liquid Remaining: O Kgal

Sludge: 4 Kgal (No change)

Saltcake: 446 Kgal

Note: Pumping was completed in September 1996 and Interim stabilization completed December 20, 1996. An in-tank video taken December 3 showed no supernate visible on the surface of the waste, which appears to be seltcake. The video shows a relatively level surface with some caving and crowning. The ENRAF level at the completion of pumping was 170.62 inches.

December 31, 1996

(c) S-110 - Following information from Cognizant Engineer:

Pumping resumed June 3, 1996, and was interrupted July 16 (see below).

Total waste: 390 Kgal (No change)
Supernate: 0 Kgal (No change)
Drainable Interstitlal Liquid: 29.8 Kgal

Pumped this Month: 0 Kgal Total Pumped: 203.1 Kgal

Drainable Liquid Remaining: 29.8 Kgal Pumpeble Liquid Remaining: 23.4 Kgal

Sludge: 131 Kgal (No change) Saltcake: 259 Kgal (No change)

Note: Pumping was interrupted July 16. Appears to be an impeller/shaft disconnect. Saltwell level was monitored until it stabilized in late September at 92 inches.

An in-tank video was taken on December 11, 1996, which showed the tank as mostly dry with some fluid in the saltwell and around the saltwell screen.

An evaluation declaring the tank interim stabilized has been drafted and is undergoing the review process. During the evaluation, conservative estimates

place porosity at .129, drainable liquid at 29.8 Kgal, and pumpable liquid at 23.4 Kgal.

(d) T-104 - Following information from Cognizant Engineer:

图-15

Pumping started March 24, 1996, and the pump failed August 26. Pump was replaced and pumping restarted September 9. Pumping was temporarily suspended

October 18 due to flammable gas issues.

Total waste: 368 Kgal

Supernate: O Kgal (No change)

Drainable Interstitial Liquid: 43.1 Kgal

Pumped this Month: O Kgal

Total Pumped: 89.0 Kgal

Drainable Liquid Remaining: 43.1 Kgal

Pumpeble Liquid Remaining: 40.1 Kgal

Sludge: 368 Kgai

Saltcake: 0 Kgal (No change)

Note: Total waste based on ENRAF level. Drainable interstitial estimates based on 20% porosity. 4 Kgal drop in overall waste volume due to pumping.

1 0

- (1

This page intentionally left blank.

APPENDIX F PERFORMANCE SUMMARY

INCREASES/DECREASES IN WASTE VOLUMES

STORED	IN DOU	BLE-SHE	L TANKS

•		THIS	FY1997
SOURCE	1	HTNON	TO DATE
B PLANT		10	24
PUREX TOTAL (1)		0	0
PFP (1)		0	0
T PLANT (1)		0	0
S PLANT (1)		0	1
300 AREAS (1)		0	8
400 AREAS (1)		0	0
SULFATE WASTE -100 N (2)		0	0
TRAINING/X-SITE (9)		0	0
TANK FARMS (6)		0	11
SALTWELL LIQUID (8)		0	17
OTHER GAINS		31	71
Slurry increase (3)	0		
Condensate	26		
Instrument change (7)	5		
Unknown (5)	' 0		
OTHER LOSSES		-36	-90
Slurry decrease (3)	-7		•
Evaporation (4)	-22		
Instrument change (7)	0		•
Unknown (5)	-7		
EVAPORATED		o '	0
GROUTED		0	0

CUMULATIVE EVAPORATION - 1950 TO PRESENT

WASTE VOLUME REDUCTION

7172
9181
11876
15295
7965
24471
41983
73689
ongo

Footnotes: See Next Page

HNF-EP-0182-106

TABLE F-1. PERFORMANCE SUMMARY (Sheet 2 of 2)

Footnotes:

INCREASES/DECREASES IN WASTE VOLUMES

- (1) Including flush
- (2) Sulfate waste is generated from ion exchange backflushing and sand filter clean out, resulting in sulfate waste.
- (3) Slurry increase/growth is caused by gas generation within the waste.
- (4) Aging waste tanks
- (5) Unknown waste gains or losses
- (6) Includes Tank Farms miscellaneous flushes
- (7) Liquid level measurement instrument changes from the automatic FIC to manual tape (and vice versa) result in unusual gains or losses because the manual tape may rest on an uneven crust surface giving a different reading from that of the automatic FIC.
- (8) Results from pumping of single-shell tanks to double-shell tanks.
- (9) Tracks waste being sent to the double-shell tanks from the "Precampaign Training Run." Evaporator procedures require a training run at least once per year. This also includes pressure testing and flushing of cross-site transfer lines.

WASTE VOLUME REDUCTION

- (10) Currently inoperative.
- Currently operative. The 242-A Evaporator-Crystallizer was started up March 1977, and shut down April 1989 because of regulatory issues, and remained shut down for subsequent upgrading. This evaporator operates under a vacuum, employing evaporative concentration with subsequent crystallization and precipitation of salt crystals (forming saltcake). The evaporator was restarted on April 15, 1994.

TABLE F-2. SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANKS

SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANK (DST) SYSTEM FOR DECEMBER 1996: ALL VOLUMES IN KGALS

- There was a net change of +5 Kgals in the DST system for December 1996.
- The total DST inventory as of December 31, 1996 was 19,090 Kgais.
- There was no Saltwell Liquid (SWL) transferred to the East or West Area DSTs in December.
- Tank 103-SY in 200 West Area had a gas release on December 20th. The total amount of gas released was ~1250 cubic feet. The liquid level decreased ~2.4 inches (6600 gallons) in the same time frame.

	DEC	EMBER 1996 DST WAST	E RECEIPTS		
FACILITY GENE	ERATIONS	OTHER GAINS ASSO	CIATED WITH	OTHER LOSSES ASSO	CIATED WITH
B PLANT	10 Kgal (8AP)	SLURRY	+0 Kgal	SLURRY	-7 Kgal
TOTAL	10 Kgal	CONDENSATE	+26 Kgal	CONDENSATE	-22 Kgal
		INSTRUMENTATION	+5 Kgal	INSTRUMENTATION	-0 Kgal
		UNKNOWN	+0 Kgal	UNKNOWN	-7 Kgal
		TOTAL	- ≭\$1∜gal	THE TOTAL PROPERTY OF THE PARTY	-36 Kgal

	ACTUAL DST	PROJECTED DST	MISC. DST	WVR	NET DST	TOTAL DST
	WASTE RECEIPTS	WASTE RECEIPTS	CHANGES (+/-)		CHANGE	VOLUME
OCT96	38	51	+7	0	+45	19093
NOV96	13	42	-21	0	-8	19085
DEC96	10	64	-5	0	+5	19090
JAN97		61		0		
FEB97		148		-503		
MAR97		157		0		
APR97		170		0	`	
MAY97		194		0		
JUN97		184		0		
JUL97		286		-759		
AUG97		374		0		
SEP97		355		0	-	

NOTE: The WVR numbers in February and July 1997 are projected Waste Volume Reductions through the 242-A Evaporator.

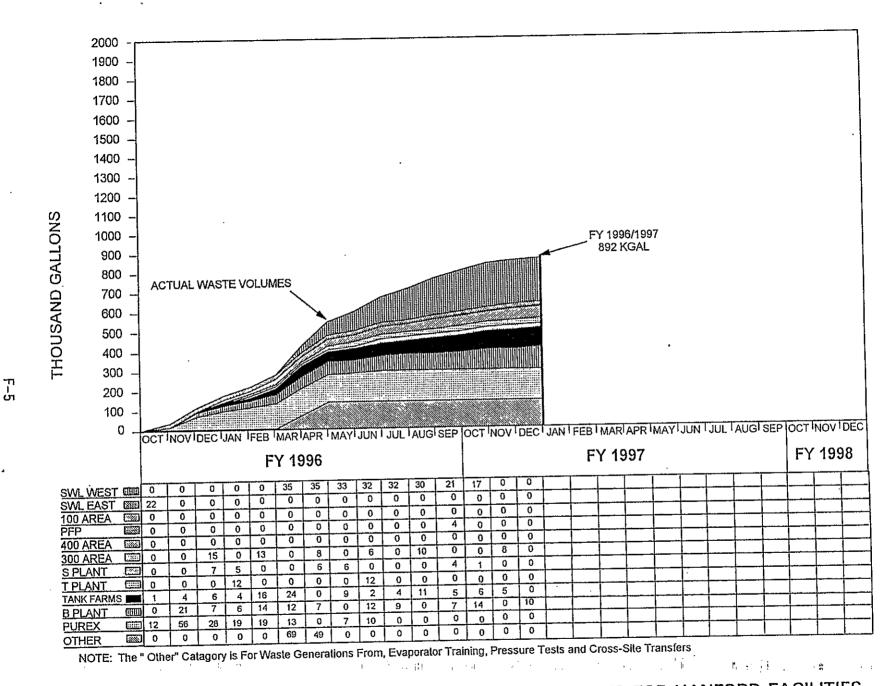


FIGURE F-1. COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES (ALL VOLUMES IN KGALS)

This page intentionally left blank

APPENDIX G

MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

TABLE G-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements

December 31, 1996

VOLUME

OF

CONTENTS MONITORED

			CONTENTS	INUIVITURED	
FACILITY .	<u>LOCATION</u>	PURPOSE (receives waste from:)	(Gallons)	<u>BY</u>	<u>BEMARKS</u>
EAST AREA					
241-A-302-A	A Farm	A-151 DB	454	SACS/DIP TUBE	Increase from drain off from Diversion Box
241-ER-311	B Plant	ER-151, ER-152 DB	2634	SACS/CASS/FIC	Increase from drain off from Diversion Box
241-AX-152	AX Farm	AX-152 DB	3712	SACS/MT	DIAL O/S, using MT, pumped 10/4/96, increase from drain off from Diversion Box
241-AZ-151	AZ Farm	AZ-152 DB, AZ Loop Seal	5113	SACS/CASS/FIC	Volume changes daily (pumped in Dec.96)
241-AZ-154	AZ Farm	AZ-102 Htg coil steam condensate	0	SACS/CASS/MT	Automatic Pump
244-BX-TK/SMP	BX Complex	DCRT - Receivers from several farms	18145	SACS/MANUALLY	Using Manual Tape for tank
244-A-TK/SMP	A Complex	DCRT - Receives from several ferms	4209	MCS	WTF
A-350	A Farm	Collects drainage	409	SACS/MT	WTF, PUMPED 12/12/96
AR-204	AY Farm	RR Cars during transfer to rec. tanks	650	DIP TUBE	Alarms on CASS
A-417	A Farm	A-702 Process condensate	17047	SACS/DIP TUBE	WTF. pumped 12/12/96
CR-003-TK/SMP	C Farm	DCRT	4057	MT/ZIP CORD	Zip cord in sump O/S 3/11/96
WEST AREA			,		
241-TX-302-C	TX Farm	TX-154 DB	6040	SACS/CASS/ENRAF	
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DB	7947	SACS/CASS/ENRAF	Returned to service 12/30/93
241-UX-302-A	U Plant	UX-154 DB	7115	SACS/CASS/ENRAF	
241-S-304	S Farm	S-151 DB	2465	SACS/RS	10/91, replaced S-302-A, Manual FIC
244-S-TK/SMP	S Farm	DCRT - Receives from several farms	7340	SACS/MANUALLY	CWF
244-TX-TK/SMP	TX Farm	DCRT - Receives from several farms	8612	SACS/MANUALLY	MT
Vent Station Catch 1	lank	Cross Country Transfer Line	277	SACS/MANUALLY	MT
		Total Active Facilities 18	LEGEND: [DB - Diversion Box	

Note: Readings may be taken manually or automatically by FIC (or ENRAF). All FIC/ENRAF are connected to CASS. All tanks on CASS (alther auto or manual) are also on the SACS database. It automatic connections to CASS are broken, readings are taken manually. Manual readings include readings taken by manual tape, manual FIC, or manual readings of automatic FIC (if CASS is printing "O"). Readings may also be taken by zip cord, which are acceptable but less accurate.

LEGEND: DB Diversion Box

DCRT - Double-Contained Receiver Tank

TK - Tank

SMP - Sump

FIC - Food Instrument Corporation measurement device

RS - Robert Shaw Instrument measurement device

MFIC - Mahual FIC

MT - Mahual Taps

CWF - Weight Factor/SpG = Corrected Weight Factor

CASS - Computer Automated Surveillance System

SACS - Surveillance Automated Control System

MCS - Monitor and Control System

O/S - Out of Service

ENRAF - Surface Level Measuring Davice

TABLE G-2. EAST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES

INACTIVE - no longer receiving waste transfers

December 31, 1996

VOLUME OF

CONTENTS MONITORED

<i>FACILITY</i>	LOCATION	RECEIVED WASTE FROM:	(Gallons)	<u>BY</u>	<u>REMARKS</u>
216-BY-201	BY Farm	· TBP Waste Line	Unknown	NM	(216-BY)
241-A-302-B	A Farm	A-152 DB	5098	CASS/MT	Isolated 1985, Project B-138 Interim Stabilized 1990
241-AX-151	N of PUREX	PUREX	Unknown	NM	Isolated 1985
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	isolated 1985 (1)
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-CX-70	Hot Semi-	Transfer lines	Unknown	NM	Isolated, Decommission Project,
241-CX-72	Works	Transfer lines	. 650	NM	See Dwg H-2-95-501, 2/5/87
241-ER-311A	SW B Plant	ER-151 DB	Unknown	NM	Isolated
244-AR VAULT	A Complex	Between farms & B-Plant	Unknown	МИ	Not actively being used. Systems activated for final clean-out.
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	МИ	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM ·	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	MM	Interim Stabilization 1985 (1)
361-B-TANK	B Plant	Drainage from B-Plant	Unknown	NM	Interim Stabilization 1985 (1)
		Total Fact Area Inactive facilities	19	I EGEND	OB - Divaraion Box

|Total East Area Inactive facilities 18

DCRT - Double-Contained Receiver Tank MT - Manual Tape CASS - Computer Automated Surveillance System TK + Tank SMP - Sump R - Usually denotes replacement NM - Not Monitored

⁽¹⁾ SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document

TABLE G-3. WEST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES

INACTIVE - no longer receiving waste transfers

December 31, 1996

VOLUME OF

CONTENTS MONITORED

<u>EACILITY</u>	LOCATION	RECEIVED WASTE FROM:	(Gallons)	<u>BY</u>	<u>REMARKS</u>
216-TY-201	E. of TY Farm	Supernate from T-112	Unknown	NM	Isolated
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
240-S-302	\$ Farm	240-S-151 DB	1627	CASS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	7601	CASS/FIC *	Assumed Leaker TF-EFS-90-042
			* FIC in Intrus	sion mode	Partially filled with grout 2/91, determined
					still assumed leaker after leak test
241-S-302-B	S Farm	S Encasements	Unknown	NM	Isolated 1985 (1)
241-SX-302	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-SX-304	SX Farm	SX-152 Transfer Box, SX-151 DB	Unknown	NM	Isolated 1985 (1)
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown	NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	1460	CASS/MT	New MT installed 7/16/93
241-TX-302B(R)	E. of TX Farm	TX-155 DB	Unknown	MM	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Unknown	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	MM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	N. of S Farm	Pers. Decon. Facility	Unknown	MM	Isolated
244-U-TK/SMP	U Farm	DCRT - Receives from several farms	Unknown	МИ	Not yet in use
244-TXR VAULT	TX Farm	Transfer lines	Unknown	MM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	MN	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
270-W	SE of U Plant	Condensate from U-221	Unknown	NM	Isolated 1970
361-T-TANK	T Plant	Drainage from T-Plant	Unknown	NM	Isolated 1985 (1)
361-U-TANK	U Plant	Drainage from U-Plant	Unknown	NM	Interim Stabilzed, MT removed 1984 (1)

Total West Area inactive facilities 27

LEGEND: DB - Diversion Box, TB - Transfer Box

DCRT - Double-Contained Receiver Tank

TK - Tank

SMP - Sump

R - Usually denotes replacement

FIG - Surface Leval Monitoring Device.

MT - Manual Tape

O/S - Out of Service

CASS - Computer Automated Surveillance System

NM - Not Monitored

ENRAF - Surface Leval Monitoring Device

APPENDIX H LEAK VOLUME ESTIMATES

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 2)

December 31, 1996 Date Declared Associated Interim Confirmed or Volume **KiloCuries** Stabilized Leak Estimate Assumed Leaker 137 cs Date Updated Reference Tank No. (Gallons) 1987 5500 06/88 1987 **(j)** 241-A-103 500 to 2500 0.8 to 1.8 (q) 85 to 760 (b) (a) (q) (b),(c) 09/78 1983 241-A-104 1975 1991 10000 to 07/79 241-A-105 1963 277000 09/88 241-AX-102 1988 3000 1989 (h) 241-AX-104 1977 08/81 1989 (g) 1989 241-B-101 1974 03/81 (g) 02/85 12/84 241-B-103 1978 1989 (g) 1989 241-B-105 1978 (g) (d),(f) 241-B-107 1980 8000 03/85 1986 241-B-110 1981 10000 03/85 1986 (d) 1978 06/85 1989 (g) 241-B-111 2000 05/85 1989 241-B-112 1978 (g) 08/81 1984 (e),(f) 1200 241-B-201 1980 (d) 300 06/84 1986 241-B-203 1983 06/84 1989 1984 (g) 241-B-204 **4**00 (g) (d) (d) 241-BX-101 1972 09/78 1989 241-BX-102 241-BX-108 70000 50 (I) 11/78 1986 1971 1974 2500 0.5 iii 07/79 1986 241-BX-110 1976 08/85 1989 (g) 241-BX-111 1993 1984 03/95 $(g)_{r}(r)$ 241-BY-103 1973 <5000 N/A 1983 (a) (g) (g) N/A 241-BY-105 1984 1989 241-BY-106 1984 N/A 1989 241-BY-107 1984 15100 07/79 1989 (g) 02/85 1983 (a) 1972 <5000 241-BY-108 241-C-101 1980 20000 11/83 1986 (d) 241-C-110 1984 2000 05/95 1989 (g) (g) (i) 241-C-111 1968 5500 03/84 1989 241-C-201 1988 550 03/82 1987 08/81 1987 (i) 241-C-202 1988 450 1986 400 03/82 (d) 1984 241-C-203 (i) 241-C-204 1988 350 09/82 1987 1968 24000 12/84 1989 (g) 241-S-104 241-SX-104 241-SX-107 1988 6000 N/A 1988 (k) 10/79 (a) 1964 <5000 1983 241-SX-108 2400 to 17 to 140 (m) (q 08/79 1991 1962 (m) (q) 35000 241-SX-109 1965 <10000 <40 (n) 05/81 1992 (n) 241-SX-110 1976 5500 08/79 1989 (g) 0.6 to 2.4 (I) (q) 500 to 2000 07/79 1986 241-SX-111 1974 (d) (q) (d) (d) 1986 241-SX-112 1969 30000 40 07/79 1986 (1) 241-SX-113 1962 15000 8 11/78 241-SX-114 07/79 1989 (g) 1972 50000 21 09/78 1992 241-SX-115 1965 (0) (0) 04/93 1992 241-T-101 1992 7500 (p) (g) (d) 11/83 1989 241-T-103 1974 < 1000 40 (1) 115000 1986 08/81 241-T-106 1973 1989 (g) (f) 05/96 241-T-107 1984 <1000 11/78 1980 241-T-108 1974 (g) (f)(t) 1989 241-T-109 12/84 1974 < 1000 1994 1979, 1994 <1000 02/95 241-T-111 (g) (d) 04/83 1989 241-TX-105 1977 2500 1986 10/79 241-TX-107 1984 (g) (g) (g) 1989 1977 1974 04/83 241-TX-110 241-TX-113 241-TX-114 241-TX-115 241-TX-116 04/83 1989 __ 1974 1977 04/83 1989 ٠. 09/83 1989 --04/83 1989 (g) 1977 .. 241-TX-117 03/83 1989 1977 (g) < 1000 04/83 1980 (f) 241-TY-101 1973 241-TY-103 241-TY-104 (d) 3000 0.7 (1) 02/83 1986 1973 1981 1400 11/83 1986 (d) 241-TY-105 1986 (d) 1960 35000 4 02/83 241-TY-106 1986 1959 20000 2 (1) 11/78 (d) 20 09/79 1986 (d) 241-U-101 1959 30000 (1) 0.09 (1) 1986 (d) 241-U-104 1961 55000 10/78 241-U-110 12/84 1986 (d) (q) 5000 to 8100 0.05 (q) 1975 09/79 1986 (d) 241-U-112 1980 8500 67 Tanks <600,000 - 900,000

N/A = not applicable (not yet interim stabilized)

Footnotes: See next page

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 2 of 2)

References:

- (a) Murthy, K.S., et al, June 1983, <u>Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington</u>, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, Tank 241-A-105 Leak Assessment, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, Tank 241-A-105 Evaporation Estimate 1970 Through 1978, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, <u>Single-Shell Tank Isolation Safety Analysis Report</u>, SD-WM-SAR-006, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, <u>Waste Status Summary</u>, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, <u>Assessment of the Surveillance Program of the High-Level Waste Storage</u>
 Tanks at Hanford, Hanford Engineering Development Laboratory, Richland, Washington.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, <u>Single-Shell Tank Leak Volumes</u>, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, <u>Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102</u>, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, <u>Liquid Level Losses in Tanks</u> 241-C-201, -202 and -204, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R. and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, <u>Tank 103-A Integrity Evaluation</u>, Westinghouse Hanford Company, Richland, Washington.
- (k) Campbell, G. D., July 8, 1988, Internal Memorandum to R. K. Welty, Engineering Investigation:
 Interstitial Liquid Level Decrease in Tank 241-SX-104, 13331-88-416, Westinghouse Hanford Company,
 Richland, Washington.
- (I) ERDA, 1975, <u>Final Environmental Statement Waste Management Operations</u>, <u>Hanford Reservation</u>, <u>Richland</u>, <u>Washington</u>, <u>ERDA-1538</u>, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, Tank 241-SX-108 Leak Assessment, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, Tank 241-SX-109 Leak Assessment, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, <u>Tank 241-SX-115 Leak Assessment</u>, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.
- (p) WHC, 1992d, Occurrence Report, "Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing," RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC-1990b, <u>A History of the 200 Area Tank Farms</u>, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1993, Occurrence Report, <u>Single-Shell Underground Waste Storage Tank 241-BX-111 Surface Level Decrease and Change From Steady State Condition</u>, RL-WHC-TANKFARM-1993-0035, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1993a, Assessment of <u>Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106, WHC-SD-EN-TI-185</u>, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (t) WHC, 1994, Occurrence Report, "Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker," RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.

This page intentionally left blank

APPENDIX I

INTERIM STABILIZATION STATUS CONTROLLED, CLEAN, AND STABLE STATUS

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (Sheet 1 of 2)

December 31, 1996

	<u> </u>	Interim	1		1	<u> </u>	Interim	T	330	3	<u></u>	l Industria	1
	Tle	Į.	Carlis		Table	T	1	04-Lil				Interim	
Tank	Tank	Stabil.	Stabil.		Tank	Tank	Stabil.	Stabil.		Tank	Tank	Stabil.	Stabil.
Number	Integrity	Date (1)	Method		Number	Integrity	<u>Date (1)</u>	Method		Number	Integrity	Date (1)	Method
A-101 A-102	SOUND	N/A 08/89	SN	9000 8000	C-101	ASMD LKR SOUND	11/83	AR JET	-33	T-108	ASMD LKR	11/78	AR
A-102 A-103	ASMD LKR	06/88	AR	600 300	C-102 C-103	SOUND	09/95 N/A	JEI	300	T-109 T-110	ASMD LKR	12/84	AR
A-104	ASMD LKR	09/78	AR		C-103	SOUND	09/89	SN		T-110	SOUND ASMD LKR	N/A	1,555
A-105	ASMD LKR	07/79	AR		C-105	SOUND	10/95	AR (5)		T-112	SOUND	02/95	JET
A-106	SOUND	08/82	AR		C-105	SOUND	N/A	An (S)	*	T-201	SOUND	03/81	AR(2)(3)
AX-101	SOUND	N/A	An		C-107	SOUND	09/85	JET	***	T-202		04/81	AR (3)
AX-101	ASMD LKR	09/88	SN		C-108	SOUND	03/84	AR		T-203	SOUND	08/81	AR
AX-102	SOUND	08/87	AR		C-108	SOUND	11/83	AR	100	T-204		04/81	AR
AX-104	ASMD LKR	08/81	AR		C-110	ASMD LKR	05/95	JET	-800 370	TX-101	SOUND	08/81	AR
B-101	ASMD IKR	03/81	SN		C-111	ASMD LKR	03/84	SN	33	TX-101	SOUND	02/84 04/83	AR JET
B-102	SOUND	08/85	SN		C-112	SOUND	09/90	AR	-000 -000	TX-102	SOUND	08/83	JET
B-103	ASMD IKR	02/85	SN		C-201	ASMD LKR	03/82	AR	5000	TX-103	SOUND	09/79	SN
B-104	SOUND	06/85	SN		C-202	ASMD LKR	08/81	AR	-000	TX-105	ASMD LKR	04/83	JET
B-105	ASMD IKR	12/84	AR	2012 3333	C-203	ASMD LKR	03/82	AR	333	TX-106	SOUND	06/83	JET
B-106	SOUND	03/85	SN		C-204	ASMD LKR	09/82	AR	***	TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN	0000 0000	S-101	SOUND	N/A			TX-107	SOUND		
B-107	SOUND	05/85	SN		S-101	SOUND		 				03/83	JET
B-108	SOUND	05/85	SN		S-102 S-103	SOUND	N/A N/A			TX-109	SOUND	04/83	JET
B-109 B-110	ASMD LKR	12/84	AR	₩	S-103 S-104	ASMD LKR	N/A 12/84	AR	₩	TX-110	ASMD LKR	04/83	JET
B-111	ASMD LKR								88	TX-111	SOUND	04/83	JET
		06/85	SN	***	S-105	SOUND	09/88	JET	*	TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	***	S-106	SOUND	N/A		883	TX-113	ASMD LKR	04/83	JEŢ
B-201	ASMD LKR	08/81	AR (3)		S-107	SOUND	N/A			TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR		S-108	SOUND	12/96	JET (7)		TX-115	ASMD LKR	09/83	JET
B-203	ASMD LKR	06/84	AR		S-109	SOUND	N/A			TX-116	ASMD LKR	04/83	JET
B-204	ASMD LKR	06/84	AR		S-110	SOUND	N/A			TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	09/78	AR		S-111	SOUND	N/A			TX-118	SOUND	04/83	JET
BX-102 BX-103	ASMD LKR SOUND	11/78	AR		S-112	SOUND	N/A	<u> </u>		TY-101	ASMD LKR	04/83	JET
BX-103	SOUND	11/83 09/89	AR(2)	880) 880)	SX-101	SOUND	N/A		***	TY-102	SOUND	09/79	AR
			SN		SX-102	SOUND	N/A			TY-103	ASMD LKR	02/83	JET
BX-105	SOUND	03/81	SN		SX-103	SOUND	N/A			TY-104	ASMD LKR	11/83	AR
BX-106	SOUND	07/95	SN		SX-104	ASMD LKR	N/A		<u></u>	TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	09/90	JET		SX-105	SOUND	N/A			TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	-	SX-106	SOUND	N/A			U-101	ASMD LKR	09/79	AR
BX-109	SOUND	09/90	JET	****	SX-107	ASMD LKR	10/79	AR		U-102	SOUND	N/A	
BX-110	ASMD LKR	08/85	SN (4)		SX-108	ASMD LKR	08/79	AR		U-103	SOUND	N/A	
BX-111		03/95	JET	****	SX-109	ASMD LKR	05/81	AR		U-104	ASMD LKR	10/78	AR
BX-112	SOUND	09/90	JET	****	SX-110	ASMD LKR	08/79	AR		U-105	SOUND	N/A	
BY-101	SOUND	05/84	JET		SX-111	ASMD LKR	07/79	SN		U-106	SOUND	N/A	
BY-102	SOUND	04/95	JET		SX-112	ASMD LKR	07/79	AR		U-107	SOUND	N/A	
BY-103	ASMD LKR	N/A		n i	SX-113	ASMD LKR	11/78	AR	***	U-108	SOUND	N/A	
BY-104	SOUND	01/85	JET	2	SX-114	ASMD LKR	07/79	AR		U-109	SOUND	N/A	
BY-105	ASMD LKR	N/A			SX-115	ASMD LKR	09/78	AR		U-110	ASMD LKR	12/84	AR
BY-106	ASMD LKR	N/A			T-101	ASMD LKR	04/93	SN		U-111	SOUND	N/A	
BY-107	ASMD LKR	07/79	JET		T-102	SOUND	03/.81	AR(2)(3)	****	U-112	ASMD LKR	09/79	AR
BY-108	ASMD LKR	02/85	JET	i i i i i i i i i i i i i i i i i i i	T-103	ASMD LKR	11/83	AR	2.2.2.5	U-201	SOUND	08/79	AR
BY-109	SOUND	N/A			T-104	SOUND	N/A		****	U-202	SOUND	08/79	SN
BY-110	SOUND	01/85	JET	***	T-105	SOUND	06/87	AR		U-203	SOUND	08/79	AR
BY-111	SOUND	01/85	JET		T-106	ASMD LKR	08/81	AR		U-204	SOUND	08/79	SN
3Y-112	SOUND	06/84	JET	8	T-107	ASMD LKR	05/96	JET					
LEGEND: AR = Administratively interim stabilized JET = Saltwell jet pumped to remove drainable interstitial liquid SN = Supernate numbed (Non-let numbed)							abilized Tank iterim Stabiliz		116 33				
SN = Supernate pumped (Non-Jet pumped) N/A = Not yet interim stabilized ASMD LKR = Assumed Leaker							Total :	Single-Shell T	anks	149			

Footnotes: See next page

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (sheet 2 of 2)

Footnotes:

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Originally, seven tanks (B-104, B-110, B-111, BX-103, T-102, and T-112) did not meet current established supernatant and interstitial liquid interim stabilization criteria, but <u>did</u> meet the criteria in existence when they were declared interim stabilized.

B-110, B-111, U-110 were determined to have met current interim stabilization criteria, per WHC-SD-WM-ER-516-REVO, "Interim Stabilization Status of SSTs B-104, B-110, B-111, T-102, T-112, and U-110," and WHC-SD-WM-ER-518-REVO, "Investigation of Liquid Intrusion in 241-BX-103," both dated October 5, 1995.

B-104, BX-103, T-102, T-112 have been determined to meet current interim stabilization criteria as of September 30, 1996.

<u>B-202</u> was determined to no longer meet the current established criteria for 200-series tanks due to a steady increase in the surface level indicating an ongoing intrusion based on a comparison of intank videos and subsequent evaluation in March 1996.

(3) Original Interim Stabilization data are missing on four tanks.

B-201, T-102, T-112, and T-201

- BX-110 was interim stabilized by Supernate Pumping in August 1985. Jet pumping began in December 1993 and soon stopped because of equipment failure. Due to low net volume pumped, major equipment failure, and ALARA, it was decided jet pumping would not resume. An in-tank video was taken in October 1994. Re-evaluation after review of the video indicated 1.5 Kgallons of waste was pumped. (Almost 3 Kgallons of water flushes were needed to produce 1.5 Kgallons tank waste.)
- (5) C-105 was interim stabilized administratively on October 30, 1995. No jet pumping occurred in this tank, nor does interstitial liquid level data exist for this tank. There are no diptubes or LOMs installed. Approximately 12 Kgallons of liquid waste was evaporated between May 1993 and October 1995. An in-tank video taken August 30, 1995, revealed a shallow supernatant pool surrounded by a 5-8 foot solids waste shore. The volume of supernate is estimated as 2 Kgallons. The tank currently meets the established criteria for declaring single-shell tanks Interim Stabilized.
- (6) T-107 was interim stabilized by Supernate Pumping in May 1996. Pumping was completed in March, and an in-tank video taken in May showed no supernate visible on the surface. The surface has an irregular contour of mostly sludge, and the elevation differences between high and low points appear to be about four inches.
- (7) S-108 was interim stabilized by Supernate Pumping in December 1996. Pumping was completed in September and an in-tank video taken in December showed no supernate visible on the surface of the waste, which appears to be saltcake. The video shows a relatively level surface with some caving and crowning. The ENRAF level at the completion of pumping was 170.62 inches (448.7 Kgallons).

TABLE I-2. TRI-PARTY AGREEMENT SINGLE-SHELL TANK INTERIM STABILIZATION SCHEDULE

As part of the Controlled, Clean, and Stable mission, the Single-Shell Tank Interim Stabilization Project goal is to mitigate the risk to the environment from a leak release from aging SSTs, by removing as much of the drainable liquid as practical, for safe storage prior to full waste retrieval.

New TPA milestones were negotiated effective October 1, 1996, to allow greater flexibility in the sequencing of tanks, in light of the latest technical information regarding tank waste safety status and watch list concerns.

Milestone	Description	Due Date	Actual Date	Comments
M-41-20	Start Interim Stabilization of 4 Single-Shell Tanks	9/30/96	3/24/96	S-108, S-110, T- 104, and T-107 started.
M-41-21	Start Interim Stabilization of 2 Single-Shell Tanks	3/31/97		BY-109 started 9/10/96; Scheduled: A-101
M-41-22	Start Interim Stabilization of 6 Single-Shell Tanks	9/30/97		Scheduled: AX-101, BY-103, BY-105, BY- 106, SX-104, T-110
M-41-23	Start Interim Stabilization of 8 Single-Shell Tanks	3/31/98		Tanks to be determined.
M-41-24	Start Interim Stabilization of 9 Single-Shell Tanks	9/30/98		Tanks to be determined.
M-41-25	Start Interim Stabilization of 3 Single-Shell Tanks	3/31/99		Tanks to be determined.
M-41-26	Start Interim Stabilization of 2 Single-Shell Tanks	9/30/99		Tanks to bedetermined.
M-41-27	Complete Saltwell Pumping of Single- Shell Tanks	9/30/00		

TABLE I-3. SINGLE-SHELL TANKS CONTROLLED, CLEAN, AND STABLE (CCS) STATUS

The Controlled, Clean, and Stable (CCS) Mission Goals are to substantially reduce the operations and maintenance costs for the Single-Shell Tank Farms, to operate within the safety envelope, remove pumpable liquid wastes and contaminated soils/debris, and to achieve compliance with near-term regulatory requirements.

Facility	Completion Due	Completed	Comments
TY-Farm	December 29, 1995	December 29, 1995	Officially designated CCS in March 1996
BX-Farm	September 30, 1996	September 19, 1996	BX-103 has been declared to have met current interim stabilization criteria, and is therefore included in CCS
TX-Farm	September 30, 1996	September 17, 1996	
T-Farm (1)	June 30, 1997		
B-Farm (1)	September 30, 1997		
BY-Farm (1)	September 30, 1997		

(1) Controlled, clean, and stable activities have been deferred on these tank farms until funding is available

This page intentionally left blank

APPENDIX J CHARACTERIZATION PROGRESS STATUS

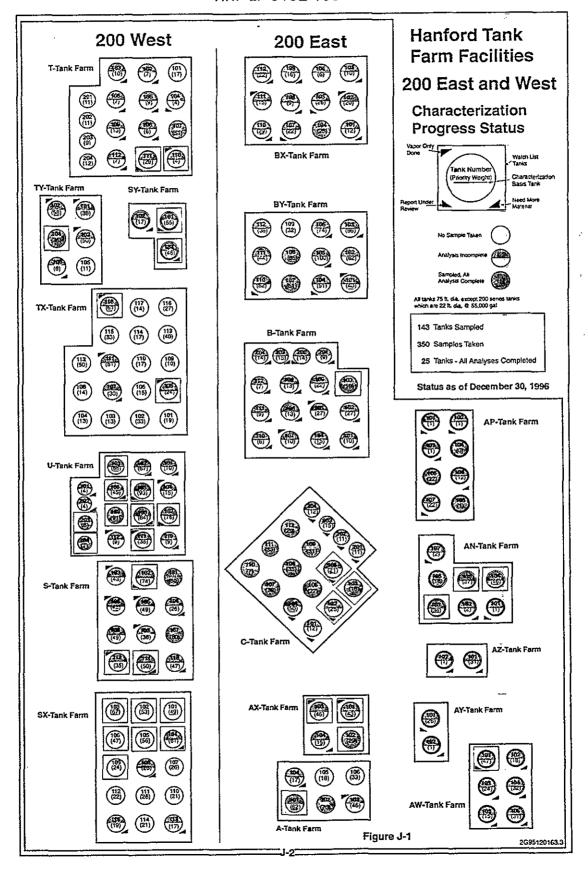


FIGURE J-1: CHARACTERIZATION PROGRESS STATUS CHART LEGEND

200 East/West	The chart divides the two areas.
Tank Farms	Each tank farm is represented by a rough schematic of the tank layout and a heading naming the farm.
Circles	Tanks are depicted by a circle for single-shell tanks and a double circle for double-shell tanks.
Boxes	A thin line box around a tank inside a tank farm denotes "Watch List" status, in concurrence with Table A-1 of this document.
Numbers in Circles	The top number is the tank number. The number in parentheses is a weighted priority number, described in WHC-SD-WM-TA-164, "Tank Waste Characterization Basis." The numbers can be compared to each other to gain appreciation of relative priority: the higher the number, the greater the priority to sample and analyze.
Underlined Numbers	If a number in parenthesis is underlined, it is denoted as a "Characterization Basis Tank," as described in WHC-SD-WM-TA-164, "Tank Waste Characterization Basis." These are key tanks taken from the priority list that are of principal interest to the Characterization Program.
Circle Shading	The shading in the circle indicates the degree to which sampling and analysis are complete per requirements described in applicable Data Quality Objectives (DQOs). If blank, no characterization sampling has taken place. If fully shaded, the sampling and analysis are complete for each DQO applicable to that tank. Tanks in which characterization has begun but is not complete are designated by being half shaded.
Corner Triangles	Small triangles near a tank circle give further information on half-shaded tanks. Upper left corner triangles indicate that vapor samples have been taken from the tank. Lower left-hand corner triangles indicate that the tank has been sampled, analyzed, and a formal report has been written on the condensed phase sampling. Further status of the tank will be determined after review of the report is complete. Lower right-hand corner triangles indicate that some review has been completed and it has been determined that more sampling is needed to resolve the DQO requirements. Absence of triangles from a half shaded tank indicates recent condensed phase sampling.

This page intentionally left blank

DISTRIBUTION

Number of copies

OFFSITE - USA

Congress of the United States
House of Representatives
1111 Longworth Building
Washington, DC 20515-3703

Ron Wyden, Member of Congress, 3rd District

House of Representatives 1431 Longworth House Office Building Washington D. C. 20515

Richard "Doc" Hastings, Member of Congress, 4th District

House of Representatives 1229 Longworth House Office Building Washington D. C. 20515

Doug Riggs, c/o Representative Doc Hastings

12 <u>U. S. Department of Energy-Headquarters</u> 1000 Independence Avenue, SW Washington, D. C. 20585

H. Calley	EM-362	'TREV II
Sherry Gibson	EM-55	TREV II
A. Griffith	EM-36	TREV II/341
D. Gupta	EM-36	TREV II
Kenneth Lang	EM-36	TREV II
C. O'Dell	EM-36	TREV II

12800 Middlebrook Rd Germantown, MD 20874

D. Pepson	EM-362	TREV II
Thomas Wright	EM-38	TREV II

19901 Germantown Rd Germantown, MD 20874-1290

L.	Gunn	EM-32 TREV II
R.	Lasky	EH-24, 270CC, MS-4033
С.	Majumdar	EM-4 Cloverleaf
J.	Psaras	EM-4 GTN

2 <u>U. S. Nuclear Regulatory Commission</u>
Division of Fuel Cycle, Safeguards & Security
Mail Stop T8-A33
Washington, DC 20555

Robert Pierson, Chief Dr. Santiago A. Parra

Washington State Department of Ecology
Nuclear & Mixed Waste Management Program
P.O. Box 47600
Olympia, WA 98504-7600

Scott McKinney
R. Stanley
Library (Michael Turner)

1 Washington State Department of Health Radiation Protection Section Industrial Park Center, Bldg 5, P. O. Box 47827 Olympia, WA 98504

A. Conklin

1 Oregon State Department of Energy 625 Marion St. NE Salem, OR 97310

Dirk Dunning

2 <u>Westinghouse Savannah River Company</u>
P. O. Box 616
Aiken, SC 29802

J. Marra 703-H Brenda Lewis 703-H

2 Argonne National Laboratory 9700 South Cass Avenue Argonne, IL 60439

> Dr. Martin Steindler, D205 Dr. George Vandergrift

Oak Ridge National Laboratory
P. O. Box 2008
Oak Ridge, TN 37831-6495

C. Forsberg MS-6180

Chemical Technology Division P. O. Box 2008 Oak Ridge, TN 37831

C. Phil McGinnis Dr. Jack Watson

Los Alamos National Laboratory
P. O. Box 1663

Los Alamos, NM 87545

Stephen Agnew Group INC-14

J-586

Brookhaven National Laboratory
P. O. Box 5000
Upton, NY 11973

K. K. Bandyopadhyay, Bldg 475-C Walter Grossman, Bldg 475-C M. Reich, Bldg 475-C

2 <u>Sandia National Laboratories</u> 1515 Eubank, NE P. O. Box 5800 Albuquerque, NM 87185

> Scott Slezak, Organization 2161, MS 0952 Norman E. Brown, Mail Stop 0734

Battelle Laboratories
505 King Avenue
Columbus, OH 43201-2693

Rob Tayloe Jr., P.E. Rm 11-10-070

1 Ames Laboratory 105 Spedding Hall Iowa State University Ames, IA 50011

Bill Haas

1 <u>Massachusetts Institute of Technology</u>
77 Massachusetts Avenue
Cambridge, MA 02139

Mujid S. Kazimi Professor and Head Department of Nuclear Engineering

SAIC 3 20300 Century Blvd, Suite 200B Germantown, MD 20874 C. Herrington J. R. Pearring 555 Quince Orchard Road, Suite 500 Gaithersburg, MD 20878 Paul Szerszen University of Washington 1 Chemical Engineering Department 355 Benson Hall, BF-10 Seattle, WA 98195 Professor Gene Woodruff University of Washington 1 Box 354695 Seattle, WA 98195 Rebecca Pixler Library Coordinator, CRESP Confederated Tribes, Umatilla Indian Reservation 1 P. O. Box 638 Pendleton, OR 97801 J. R. Wilkinson, DNR/Hanford Program Manager 5 Defense Nuclear Facilities Safety Board 625 Indiana Ave, N. W., Suite 700 Washington, D. C. 20004 Ralph Arcaro David Lowe Cliff Moore Richard Tontodonato Library 1 C. Abrams 1987 Virginia Drive Idaho Falls, ID 83404 1 Donald Oakley 9612 Hall Road Potomac, MD 20854 T. E. Larson 1 2711 Walnut St

Los Alamos, NM, 87544

1 Fluor Daniel, Inc. 3333 Michelson Drive Irvine, CA 92730 Charles Divona 1 Foster-Miller, Inc. Power Systems Technology Group 350 Second Avenue Waltham, MA 02154-1196 Maureen Williams 6 National Research Council, National Academy of Sciences 2001 Wisconsin Ave. N. W. Washington D. C. 20418 Robert S. Andrews, Senior Staff Officer, MS HA456 Board on Radioactive Waste Management 1 Dr. Frank L. Parker Professor of Environmental and Water Resources Engineering Vanderbilt University P. O. Box 1596, Station B Nashville, TN 37235 1 Dr. Bruce R. Kowalski Professor of Chemistry, Co-director of Center for Process Analytical Chemistry University of Washington Chemistry Department Seattle, WA 98195 1 Dr. Greg R. Choppin Professor of Chemistry Florida State University Department of Chemistry, B-164 Tallahassee, FL 32306 RKK Ltd. 1 16404 Smokey Pt. Blvd, Suite 303 Arlington, WA 98223 Ronald K. Kieg 1 Nuclear Consulting Services, Inc. 7000 Huntley Road P. O. Box 29151 . Columbus, OH 43229 Dr. J. Louis Kovach

Neptune & Company
1505 15th St., Suite B
Los Alamos, NM 87544

Randy Ryti

1 Government Accountability Project
West Coast Office
1402 Third Avenue, Suite 1215
Seattle, WA 98101

Thomas E. Carpenter, Director

Heart of America Northwest
1305 Fourth Avenue
Cobb Building Suite 208
Seattle, WA 98101

Gerald M. Pollet, Executive Director

2 MACTEC 8310 Centerbrook Place Alexandria, VA 22308

Stan Blacker

189 Lafayette Drive, Suite C Oak Ridge, TN 37830

Marc Boothby

1 M4 Environmental Management Inc. 227 Gateway Drive, Suite 113-D Aiken, SC 29803

Harry Harmon

1 <u>I.E.E.R.</u> 6935 Laurel Ave Takoma Park, MD 20912

Marc Fioravanti

OFFSITE - FOREIGN

Prof. Dr. Johann Korkisch
Institute of Analytical Chemistry
University of Vienna
A-1090 Vienna, Wahringerstrasse 38
Austria

TRI-CITIES:

RUST Geotech Inc.
303 Bradley Blvd, #104

Richland, WA 99336

J. F. Bertsch

2 <u>Los Alamos Technical Associates</u> 309 Bradley Blvd. Richland, WA 99352

> Karen Todd Thuy Tran

3 <u>Jason Associates</u> 3150 Port of Benton Blvd, Suite 101 Richland, WA 99352

Regan Weeks

1 TRW Environmental Systems
507 Knight St
Richland, WA 99352

Mike Leonard

1 Ogden Environmental & Energy Services
1404 Potter Ave
Richland, WA 99352

Rich Anema

Parsons Engineering Science, Inc. 1955 Jadwin Ave, Suite 410 Richland, WA 99352

Sohan S. Gahir

2 R. J. International
P. O. Box 458
Richland, WA 99352

John W. Riddington

Foster Wheeler Environmental Corp.
1981 Snyder Rd, Suite 3
Richland, WA 99352

Glen Cox

Project Time & Cost
3311 W. Clearwater Ave
Kennewick, 99336

John Escude

Chuck Mohr & Associates
1440 Agnes St.
Richland, WA 99352

Jim Hurley

3	Meier Associates, Inc. 8697 Gage Blvd. Kennewick, WA 99336	
	Terry Winward James Bingham Dave Hedengren	
1	ARES Corporation 636 Jadwin Ave., Suite B Richland, WA 99352	
	Lewis Muhlestein	
1	<u>Columbia Technology Associates, Inc.</u> 2000 Logston Blvd Richland, WA 99352	
	G. G. Trimble, Vice President	
I	<u>Babad Technical Services</u> 2540 Cordoba Court Richland, WA 99352	
ONSITE		
1	SAIC	
	G. F. Martin HO-50	
1	Stone & Webster Engineering Co.	
	E. L. Richards B4-41	
1	General Accounting Office	
	C. R. Abraham A1-80	
3	Washington State Department of Ecology	
	A. B. Stone B5-18 G. T. Tebb B5-18 Library B5-18	
1	U. S. Environmental Protection Agency	
	D. R. Sherwood B5-01	
32	U. S. Department of Energy-Richland Operations Office	<u>e</u>
	M. C. Brown S7-54 J. M. Clark S7-54 J. J. Davis S7-53	

Distr-8

	17.00
L. Erickson	A7-80
J. M. Gray	S7-54
	S7-54 S7-54
	57-54 S7-54
	H0-12
	S7-50
	S7-54
J. E. Kinzer	\$7-50
	A4-81
P. E. LaMont	S7-53
R. W. Lober	S7-51
J. D. Long	S7-41
J. K. McClusky	S7-54
S. H. Pfaff	S7-54
M. J. Royack C. O. Ruud	S7-54 S7-54
	A5-15
T. R. Sheridan	A4-70
A. B. Sidpara	S7-54
	K6-51
H. J. Wacek	S7-54
K. G. Wade	S7-54
R. K. Welty	S7-54 S7-53
C. D. West N. L. White	B4-55
D. J. Williams	S7-41
D. D. Wodrich	\$7-50
Reading Room	H2-53
Pacific Northwest Labora	atories
Tablito Not office Labor	<u> </u>
P. R. Bredt	P7-25
	P7-25
J. A. Campbell	P8-08
J. B. Colson S. D. Colson	K5-25 K2-14
W. T. Farris	K3-54
R. E. Gephart	K9-76
R. I. Hansen	K8-07
J. L. Huckaby	K6-80
V. L. Hunter	K7-97
A. F. Noonan	K9-91 K6-75
B. E. Opitz R. D. Scheele	P7-25
R. C. Schrotke	P7-34
R. D. Stenner	K3-54
D. Vela	K6-51
P. D. Whitney	K5-12
T. W. Wood	K7-94
Fluor Daniel, Inc., and	Affiliated Companies
R. Adhikari	G3-12
M. G. Al-Wazani	T4-07
J. J. Badden	T4-07

18

169

Distr-9

JDRDLGMTVDDKRRGJSWSDTMRLJKGMKTARSWLKWJGLJKJTP.	GVMCARGJHJCDLAKALAFGCLDAACWDGADM.	dford Bergquist Berriochoa Blaak Boyles Bragg Bratzel Carothers Cash Cleweland Conner Consort Cowley Davis DeFord Demitruk Dexter Dodd Dougherty Douglas Douka Dunford Ellefson Elsethagen Erickson	(6)	T4-80 R1
R. D. L. B. G. J. S. M. J.	D. B. E. K. M. P. H. E. Kal	Gustavson Hagmann Hall Hampton Hanlon Hanson Hopkins Huber Hulsey Islam	(15)	R2-50 H6-12 B4-40 S7-40 T4-08 S5-05 S5-03 T4-07 S5-12 S5-12 R2-54

С.	E.	Jarecki Jenkins Inings			S7-13 L6-37 R2-84
T. R.	L.	Jennings Jensen			R2-84 G3-21 R2-12
В.	A. D.	Johnson Johnson Jones	I	(2)	R2-84 S7-14 S5-13
R.	J.	Jones, Ji Kelley	٠.		S5-03 S7-21
T. W. R.	Α.	Kennedy Kirkbride	3		S7-03 H5-27
P. N.	F.	Kison Kirch			T4-07 R2-11
		Koch Kristofzs	ski		S8-05 R2-12
M. M.		nmerer Lane			A3-34 S8-05
J.	W.	Lechelt Lentsch			R2-11 S7-14
R.	Р.	MacLean Marshall			H5-61 H5-61
J.	E.	McCain McKinney			R2-12 R3-01
M. W.	Н.	McLaughl Meader	in		B2-35 S8-05
D. L.	C.,	Mendoza Mercado			H5-68 T4-08
N. J.	Ε.	Milliken Moore	_		A3-37 S5-10
R.	L.	Mortenser Nelson Newell	1		S7-05 T3-28 E6-40
R.	J.	Nicklas Nicholson	1		S6-72 S5-05
В. D.	j. M.	Niemi Ogden	1		A3-37 H0-34
G. M.	L. A.	Parsons Payne			R3-47 S7-84
L. R.	T.	Pedersen. Popielar			N1-46 R2-38
R. T.	L.	Powers Powers			S5-13 A3-34
T. R.	E. E.	Rainey Raymond		(2)	S7-12 S7-12
W. D.		Ross Saueress	ig		S5-07 S8-05
J. R.	D.	Schofield Schreiber	r		S7-12 R2-12
N.	J.			r	B4-51 S5-01
J.	Ε.	rrano Shapley	٦		R2-38 A2-25
J.	W. P.	Shelton Shearer	Jr.		H5-49 H0-20

D. H. Shuford	S7-01				
E. R. Siciliano	H0-31				
J. C. Sonnichsen	H6-24				
S. M. Stahl	R2-54				
E. S. Stock	R2-82				
J. N. Strode	R2-11				
J. L. Stroup	S3-09				
B. L. Syverson	H5-57				
R. R. Thompson	R2-12				
J. M. Thurman	R1-51				
A. M. Umek	S7-81				
J. E. Van Beek	S2-48				
R. J. Van Vleet	A3-34				
D. T. Vladimiroff	S8-05				
J. A. Voogd	H5-03				
A. B. Webb	A3-37				
	S5-09				
	S8-05				
R. S. Wittman	H6-35				
A. E. Young	R2-12				
B. D. Zimmerman	H6-35				
RL Docket File (2)	B1-17				
200 West Shift Office	T4-00				
200 East Shift Office	\$5-04				
Central Files	A3-88				
Health Physics	S8-05				
Environmental	30-03				
Data Mgmt Center (2)	H6-08				
Solid Waste Data	110-00				
Proc. Center	T4-03				
Unified Dose Assessment	13 00				
Center (UDAC) A0-20					
Document Proc. Center	A3-94				
Population 1100. October	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,				